

Hempstead Union Free School District

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

2020-2021



ENVIROSCIENCE
CONSULTANTS INC.

2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project #20905

Districtwide Lead in Drinking Water
Sampling and Remediation Plan

Performed for:

Hempstead Union Free School District
185 Peninsula Boulevard
Hempstead, NY 11550

June 2021

Prepared by:

Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #20905

President



Glenn Neuschwender

Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

I. Executive Summary

II. Sampling Methodology

III. Initial Results

Appendix A – Marshall School

Appendix B – Barack Obama School

Appendix C – David Patterson School

Appendix D – Front Street School

Appendix E – Jackson Annex School

Appendix F – Jackson Main School

Appendix G – Joseph A. McNeil School

Appendix H – Prospect School

Appendix I – A.B.G.S Middle School

Appendix J – Hempstead High School

Appendix K – Pupil Personnel Services

Appendix L – Administration at 100 Main Street

June 24, 2021

Allan Wakefield
Hempstead Union Free School District
185 Peninsula Boulevard
Hempstead, NY 11550

I. Executive Summary

The Hempstead Union Free School District has developed their 2020-2021 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Hempstead Union Free School District, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Home Economics and Culinary Arts classroom sinks
- 5) Elementary Classroom sinks
- 6) Bathroom sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Hempstead Union Free School District were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Other classroom sinks;
- 4) Other Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks - classrooms in this category often include classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Other bathroom sinks – this category often includes mixed valve outlets or staff bathrooms. In intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Procedures:

In accordance with the regulation, Enviroscience Consultants, Inc. performed initial water sampling throughout the Hempstead Union Free School District June 15-17, 2021. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more that 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler
 HB Hose Bib
 IM Ice Machine
 OS Other Source
 PF Pot Filler
 SK Sink
 SL Supply Line
 SP Spigot
 SPY Spray
 SS Slop Sink
 V Valve
 WC Water Cooler
 WF Water Fountain


Source Designations

App Applicable
 N/A Non-applicable

Remediation Type Codes

FR Fixture Replacement
 FRSLV Fixture, supply line or valve replacement
 FRSLVPA Fixture, supply line or valve replacement plumbing assessment
 SIGN Non-potable water sign posted
 CAPPED Supply line capped or fixture removed

Sampling Location Schematics

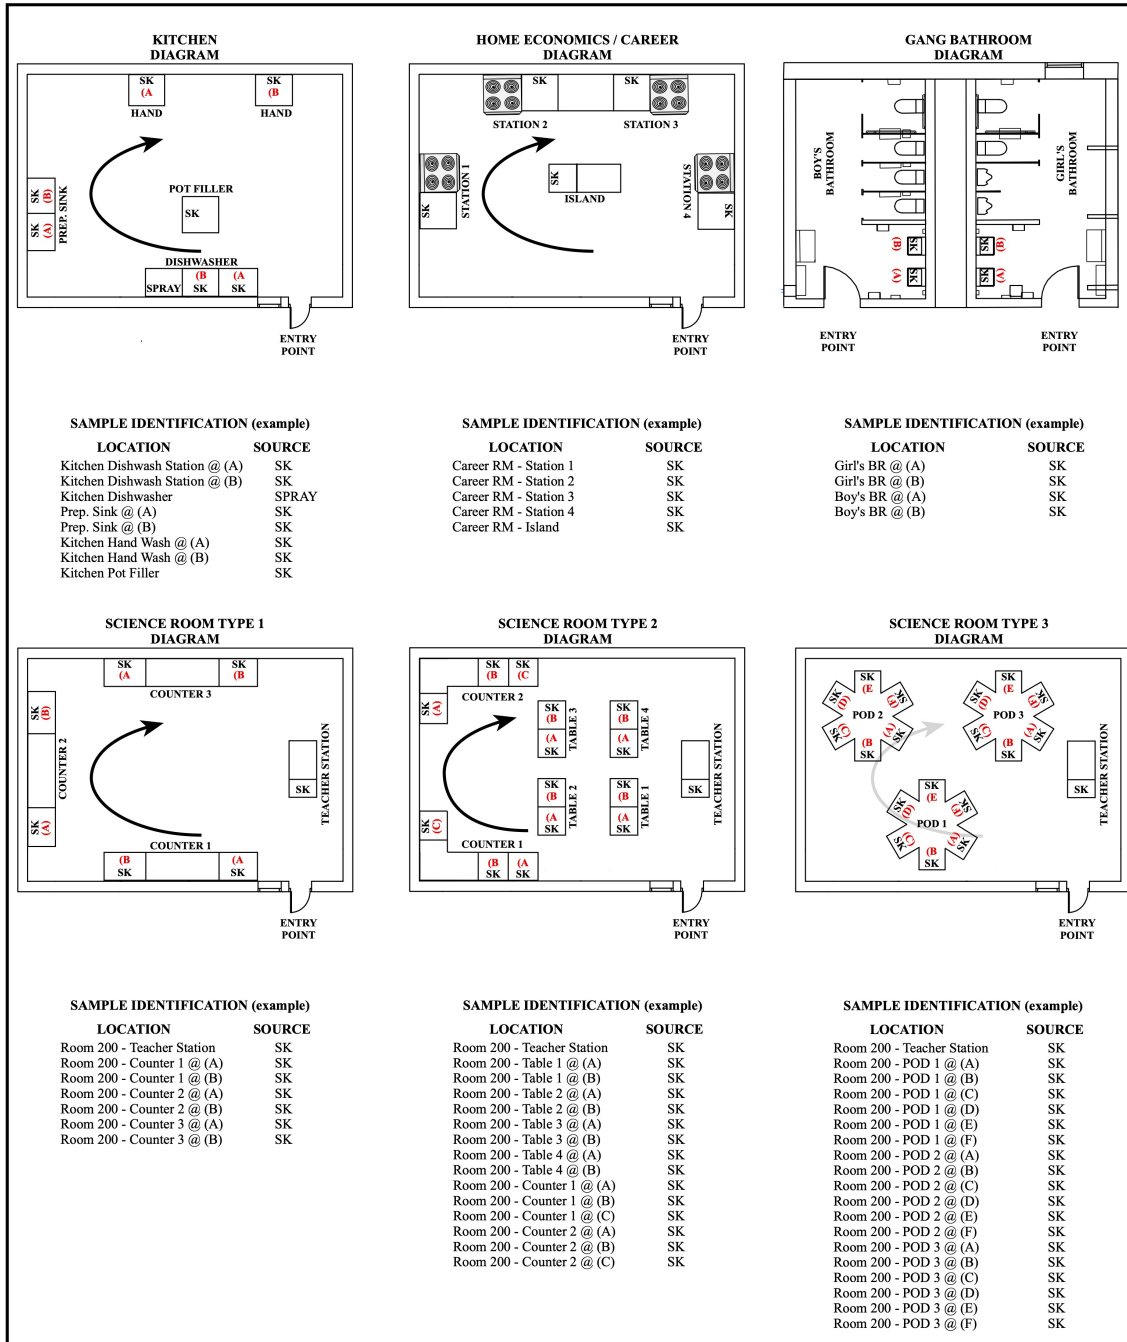

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through D).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

Marshall School – Pre Kindergarten

Portable 12 Bathroom	SK	24.5
Principal's Office Bathroom	SK	21.7
Room 4	SK	112

Barack Obama School

No Exceedances

David Patterson School

Room 18	SK	85.7
Room 20	SK	17.8

Front Street School

Men's Faculty Bathroom by Cafeteria Left	SK	15.3
Men's Faculty Bathroom by Cafeteria Right Middle	SK	19.1
Girl's Bathroom by Main Office Right	SK	21.5

Jackson Annex School

No Exceedances

Jackson Main School

Room 18	SK	28.7
---------	----	------

Joseph A. McNeil School

Faculty Lounge 38A	SK	21
Room 40	SK	264
Boys Bathroom by Room 38 (Left)	SK	35.5
Room 38	WF	216
Room 38	SK	171
ESL Room 26 Storage Closet	SK	201

Prospect School

Kitchen Serving Line Prep	SK	17.3
Room 3	SK	35.1
Room 33	WF	48.4

A.B.G.S Middle School

Staff Bathroom by Lobby (left)	SK	19.2
Room 119	SK	39.3
Women's Bathroom by Personnel (left)	SK	100
Business Office Women's Bathroom (right)	SK	19.1
Business Office Men's Bathroom (left)	SK	208

Hempstead High School

Athletic Director's Office	SK	28.1
Men's Bathroom by Room A314 Left	SK	18.1

Pupil Personnel Services Building

Room 1 Bathroom	SK	157
-----------------	----	-----

Administration at 100 Main Street

Girl's Bathroom by Computer Lab B Left Middle	SK	42.7
Girl's Bathroom by Computer Lab B Right Middle	SK	29.1
Women's Bathroom by Computer Lab B	SK	70.9
Boy's Bathroom by Data Office Left Middle	SK	43.6
Boy's Bathroom by Data Office Right	SK	15.5
Men's Bathroom by Telecommunications	SK	20.5

Appendix A

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Red & White Building-Kitchen-Single Unit	SK	App	4.99	6/15/2021	-	-	-	None	-	-	-
1002-1	Red & White Building Bathroom	SK	App	2.28	6/15/2021	-	-	-	None	-	-	-
1003-1	Portable 10 Bathroom	SK	App	1.32	6/15/2021	-	-	-	None	-	-	-
1004-1	Portable 9 Bathroom	SK	App	3.08	6/15/2021	-	-	-	None	-	-	-
1005-1	Portable 8 Bathroom	SK	App	11.7	6/15/2021	-	-	-	None	-	-	-
1006-1	Portable 6 Bathroom	SK	App	3.07	6/15/2021	-	-	-	None	-	-	-
1007-1	Portable 5 Bathroom	SK	App	6.5	6/15/2021	-	-	-	None	-	-	-
1008-1	Portable 7 Bathroom	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1009-1	Portable 11 Bathroom	SK	App	1.3	6/15/2021	-	-	-	None	-	-	-
1010-1	Portable 12 Bathroom	SK	App	24.5	6/15/2021				Additional Sampling Required			
1011-1	Room 3	SK	App	4.87	6/15/2021	-	-	-	None	-	-	-
1011-2	Room 3	WF	App		6/15/2021	-	-	-	None	Removed from service	-	-
1012-1	Room 2	SK	App	2.37	6/15/2021	-	-	-	None	-	-	-
1012-2	Room 2	WF	App		6/15/2021	-	-	-	None	Removed from service	-	-
1013-1	Hallway by Room 2	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1013-2	Hallway by Room 2	WF	App		6/15/2021	-	-	-	None	Removed from service	-	-
1014-1	Boy's Bathroom by Room 2	SK	App	2.08	6/15/2021	-	-	-	None	-	-	-
1015-1	Custodial Closet by Room 2	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
1016-1	Girl's Bathroom by Room 1	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1017-1	Room 1	SK	App		6/15/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1017-2	Room 1	WF	App		6/15/2021	-	-	-	None	Removed from service	-	-
1018-1	Basement Boiler Room	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
1019-1	Principal's Office Bathroom	SK	App	21.7	6/15/2021				Additional Sampling Required			
1020-1	Unisex Bathroom by Main Office	SK	App	1.22	6/15/2021	-	-	-	None	-	-	-
1021-1	Library Bathroom	SK	App	5.21	6/15/2021	-	-	-	None	-	-	-
1022-1	Nurse's Office	SK	App	12.7	6/15/2021	-	-	-	None	-	-	-
1023-1	Room 4	SK	App	112	6/15/2021				Additional Sampling Required			

Laboratory Report

NYE Report #: 2212753-18220

June 17, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Marshall School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 15, 2021. New York Environmental analyzed the samples on June 16, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	15 Jun 2021
Date Received:	15 Jun 2021
Date Analyzed:	16 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210615Q013	1	Red & White Building-Kitchen-Single Unit-SK; Initial	1.00	4.99	µg/L	
210615Q014	2	Red & White Building Bathroom-SK; Initial	1.00	2.28	µg/L	
210615Q015	3	Portable 10 Bathroom-SK; Initial	1.00	1.32	µg/L	
210615Q016	4	Portable 9 Bathroom-SK; Initial	1.00	3.08	µg/L	
210615Q017	5	Portable 8 Bathroom-SK; Initial	1.00	11.7	µg/L	
210615Q018	6	Portable 6 Bathroom-SK; Initial	1.00	3.07	µg/L	
210615Q019	7	Portable 5 Bathroom-SK; Initial	1.00	6.50	µg/L	
210615Q020	8	Portable 7 Bathroom-SK; Initial	1.00	<1.00	µg/L	
210615Q021	9	Portable 11 Bathroom-SK; Initial	1.00	1.30	µg/L	
210615Q022	10	Portable 12 Bathroom-SK; Initial	1.00	24.5	µg/L	H
210615Q023	11	Room 3-SK; Initial	1.00	4.87	µg/L	
210615Q024	12	Room 2-SK; Initial	1.00	2.37	µg/L	
210615Q025	13	Hallway by Room 2-BF; Initial	1.00	<1.00	µg/L	
210615Q026	14	Boy's Bathroom by Room 2-SK; Initial	1.00	2.08	µg/L	
210615Q027	15	Girl's Bathroom by Room 1-SK; Initial	1.00	<1.00	µg/L	
210615Q028	16	Principal's Office Bathroom-SK; Initial	1.00	21.7	µg/L	H
210615Q029	17	Unisex Bathroom by Main Office-SK; Initial	1.00	1.22	µg/L	
210615Q030	18	Library Bathroom-SK; Initial	1.00	5.21	µg/L	
210615Q031	19	Nurse's Office-SK; Initial	1.00	12.7	µg/L	
210615Q032	20	Room 4-SK; Initial	1.00	112	µg/L	E,H

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen 1 Bay	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1002-1	Boys Bathroom by Room 12 (Left)	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1002-2	Boys Bathroom by Room 12 (Middle Left)	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1002-3	Boys Bathroom by Room 12 (Middle Right)	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1002-4	Boys Bathroom by Room 12 (Right)	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1003-1	Custodial Closet by Room 12	SS	N/A		6/15/2020	-	-	-	None	Locked Door	-	-
1004-1	Nurses Office Bathroom	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1005-1	Hall by Room 12	WF	App		6/15/2020	-	-	-	None	Removed From Service	-	-
1005-2	Hall by Room 12	BF	App		6/15/2020	-	-	-	None	Removed From Service	-	-
1006-1	Room 6	WF	App		6/15/2020	-	-	-	None	Removed From Service	-	-
1006-2	Room 6	SK	App	9.36	6/15/2020	-	-	-	None	-	-	-
1007-1	Room 7	WF	App		6/15/2020	-	-	-	None	Removed From Service	-	-
1007-2	Room 7	SK	App	5.82	6/15/2020	-	-	-	None	-	-	-
1008-1	Room 8	WF	App		6/15/2020	-	-	-	None	Removed From Service	-	-
1008-2	Room 8	SK	App	1.79	6/15/2020	-	-	-	None	-	-	-
1009-1	Curriculum Room	SK	N/A		6/15/2020	-	-	-	None	SIGN	-	-
1010-1	Room 1	SK	App	1.5	6/15/2020	-	-	-	None	-	-	-
1011-1	Hall by Room 1	WF	App		6/15/2020	-	-	-	None	Removed From Service	-	-
1011-2	Hall by Room 1	BF	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1012-1	Girls Bathroom by Room 3 (Left)	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-2	Girls Bathroom by Room 3 (Right)	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1013-1	Custodial Closet by Room 3 Bathroom	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1013-2	Custodial Closet by Room 3	SS	N/A		6/15/2020	-	-	-	None	Locked Door	-	-
1014-1	Hall by Principals Office	WF	App		6/15/2020	-	-	-	None	Removed From Service	-	-
1014-2	Hall by Principals Office	BF	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1015-1	Faculty Bathroom by Principals Office	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1016-1	Boys Bathroom by Room 17	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1017-1	Girls Bathroom by Room 16 (Left)	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1017-2	Girls Bathroom by Room 16 (Right)	SK	App	<1.0	6/15/2020	-	-	-	None	-	-	-
1018-1	Portable Room 19 Bathroom	SK	App	1.29	6/15/2020	-	-	-	None	-	-	-
1019-1	Portable Room 21 Bathroom	SK	App	1.21	6/15/2020	-	-	-	None	-	-	-
1020-1	Portable Room 22 Bathroom	SK	App	3.23	6/15/2020	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212754-18221

June 17, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Barack Obama Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 15, 2021. New York Environmental analyzed the samples on June 16, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	15 Jun 2021
Date Received:	15 Jun 2021
Date Analyzed:	16 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210615Q033	1	Kitchen 1 Bay-SK; Initial	1.00	<1.00	µg/L	
210615Q034	2	Boys Bathroom by Room 12 (Left)-SK; Initial	1.00	<1.00	µg/L	
210615Q035	3	Boys Bathroom by Room 12 (Middle Left)-SK; Initial	1.00	<1.00	µg/L	
210615Q036	4	Boys Bathroom by Room 12 (Middle Right)-SK; Initial	1.00	<1.00	µg/L	
210615Q037	5	Boys Bathroom by Room 12 (Right)-SK; Initial	1.00	<1.00	µg/L	
210615Q038	6	Nurses Office Bathroom-SK; Initial	1.00	<1.00	µg/L	
210615Q039	7	Room 6-SK; Initial	1.00	9.36	µg/L	
210615Q040	8	Room 7-SK; Initial	1.00	5.82	µg/L	
210615Q041	9	Room 8-SK; Initial	1.00	1.79	µg/L	
210615Q042	10	Room 1-SK; Initial	1.00	1.50	µg/L	
210615Q043	11	Hall by Room 1-BF; Initial	1.00	<1.00	µg/L	
210615Q044	12	Girls Bathroom by Room 3 (Left)-SK; Initial	1.00	<1.00	µg/L	
210615Q045	13	Girls Bathroom by Room 3 (Right)-SK; Initial	1.00	<1.00	µg/L	
210615Q046	14	Custodial Closet by Room 3 Bathroom-SK; Initial	1.00	<1.00	µg/L	
210615Q047	15	Hall by Principals Office-BF; Initial	1.00	<1.00	µg/L	
210615Q048	16	Faculty Bathroom by Principals Office-SK; Initial	1.00	<1.00	µg/L	
210615Q049	17	Boys Bathroom by Room 17-SK; Initial	1.00	<1.00	µg/L	
210615Q050	18	Girls Bathroom by Room 16 (Left)-SK; Initial	1.00	<1.00	µg/L	
210615Q051	19	Girls Bathroom by Room 16 (Right)-SK; Initial	1.00	<1.00	µg/L	
210615Q052	20	Portable Room 19 Bathroom-SK; Initial	1.00	1.29	µg/L	
210615Q053	21	Portable Room 21 Bathroom-SK; Initial	1.00	1.21	µg/L	
210615Q054	22	Portable Room 22 Bathroom-SK; Initial	1.00	3.23	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation



Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Handwash	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1002-1	Custodial Closet By Room 6	SS	N/A		6/16/2021	-	-	-	None	Locked Door	-	-
1003-1	Women's Bathroom by Room 6 Left	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1003-2	Women's Bathroom by Room 6 Right	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1004-1	Hall by Room 6	WF	App		6/16/2021	-	-	-	None	Removed From Service	-	-
1005-1	Hall by Room 9	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1005-2	Hall by Room 9	WF	App		6/16/2021	-	-	-	None	Removed From Service	-	-
1006-1	Boy's Bathroom by Room 10 Left	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1006-2	Boy's Bathroom by Room 10 Right	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1007-1	Faculty Room Bathroom	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1008-1	Boy's Bathroom by Room 23	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1009-1	Girl's Bathroom by Room 23 Left	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1009-2	Girl's Bathroom by Room 23 Right	SK	App		6/16/2021	-	-	-	None	Removed From Service	-	-
1010-1	Room 21	SK	App	2.66	6/16/2021	-	-	-	None	-	-	-
1011-1	Room 18	SK	App	85.7	6/16/2021				Additional Sampling Required			
1012-1	Hall by Room 19	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1012-2	Hall by Room 19	WF	App		6/16/2021	-	-	-	None	Removed From Service	-	-
1013-1	Room 19	SK	App		6/16/2021	-	-	-	None	Removed From Service	-	-
1014-1	Room 20	SK	App	17.8	6/16/2021				Additional Sampling Required			
1014-2	Room 20	WF	App		6/16/2021	-	-	-	None	Removed From Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1015-1	Hall by Room 23	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1015-2	Hall by Room 23	WF	App		6/16/2021	-	-	-	None	Removed From Service	-	-
1016-1	Men's Bathroom by Room 26 Left	SK	App	1.42	6/16/2021	-	-	-	None	-	-	-
1016-2	Men's Bathroom by Room 26 Right	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1017-1	Media Center Bathroom	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1018-1	Nurse's Office Bathroom	SK	App	3.04	6/16/2021	-	-	-	None	-	-	-
1019-1	Portable A Bathroom	SK	App	6.66	6/16/2021	-	-	-	None	-	-	-
1020-1	Portable B Bathroom	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1021-1	Portable D Bathroom	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1022-1	Portable C Bathroom	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212809-18246

June 21, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: David Patterson Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 17, 2021. New York Environmental analyzed the samples on June 18, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	16 Jun 2021
Date Received:	17 Jun 2021
Date Analyzed:	18 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210617Q180	1	Women's Bathroom by Room 6 Left-SK; Initial	1.00	<1.00	µg/L	
210617Q181	2	Women's Bathroom by Room 6 Right-SK; Initial	1.00	<1.00	µg/L	
210617Q182	3	Hallway by Room 9-BF; Initial	1.00	<1.00	µg/L	
210617Q183	4	Boy's Bathroom by Room 10 Left-SK; Initial	1.00	<1.00	µg/L	
210617Q184	5	Boy's Bathroom by Room 10 Right-SK; Initial	1.00	<1.00	µg/L	
210617Q185	6	Faculty Room Bathroom-SK; Initial	1.00	<1.00	µg/L	
210617Q186	7	Boy's Bathroom by Room 23-SK; Initial	1.00	<1.00	µg/L	
210617Q187	8	Girl's Bathroom by Room 23 Left-SK; Initial	1.00	<1.00	µg/L	
210617Q188	9	Room 21-SK; Initial	1.00	2.66	µg/L	
210617Q189	10	Room 18-SK; Initial	1.00	85.7	µg/L	E,H
210617Q190	11	Hallway by Room 19-BF; Initial	1.00	<1.00	µg/L	
210617Q191	12	Room 20-SK; Initial	1.00	17.8	µg/L	H
210617Q192	13	Hallway by Room 23-BF; Initial	1.00	<1.00	µg/L	
210617Q193	14	Men's Bathroom by Room 26 Left-SK; Initial	1.00	1.42	µg/L	
210617Q194	15	Men's Bathroom by Room 26 Right-SK; Initial	1.00	<1.00	µg/L	
210617Q195	16	Media Center Bathroom-SK; Initial	1.00	<1.00	µg/L	
210617Q196	17	Nurse's Office Bathroom-SK; Initial	1.00	3.04	µg/L	
210617Q197	18	Portable A Bathroom-SK; Initial	1.00	6.66	µg/L	
210617Q198	19	Portable B Bathroom-SK; Initial	1.00	<1.00	µg/L	
210617Q199	20	Portable D Bathroom-SK; Initial	1.00	<1.00	µg/L	
210617Q200	21	Portable C Bathroom-SK; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



Appendix D

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-01	Kitchen 3-Bay Left	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
0001-02	Kitchen 3-Bay Middle	SK	App	5.14	6/17/2021	-	-	-	None	-	-	-
0001-03	Kitchen 3-Bay Right	SK	App	1.99	6/17/2021	-	-	-	None	-	-	-
0002-01	Custodial Office	SK	N/A		6/17/2021	-	-	-	Sign Required	-	-	-
0003-01	Women's Faculty Bathroom by Cafeteria Left	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
0003-02	Women's Faculty Bathroom by Cafeteria Left Middle	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
0003-03	Women's Faculty Bathroom by Cafeteria Right Middle	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
0003-04	Women's Faculty Bathroom by Cafeteria Right	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
0004-01	Custodial Closet by Cafeteria	SS	N/A		6/17/2021	-	-	-	None	Locked Door	-	-
0005-01	Men's Faculty Bathroom by Cafeteria Left	SK	App	15.3	6/17/2021				Additional Sampling Required			
0005-02	Men's Faculty Bathroom by Cafeteria Left Middle	SK	App	3.99	6/17/2021	-	-	-	None	-	-	-
0005-03	Men's Faculty Bathroom by Cafeteria Right Middle	SK	App	19.1	6/17/2021				Additional Sampling Required			
0005-04	Men's Faculty Bathroom by Cafeteria Right	SK	App	2.24	6/17/2021	-	-	-	None	-	-	-
1001-01	Boy's Bathroom by Main Office Left	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1001-02	Boy's Bathroom by Main Office Left Middle	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1001-03	Boy's Bathroom by Main Office Right Middle	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1001-04	Boy's Bathroom by Main Office Right	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1002-01	Custodial Closet by Main Office	SS	N/A	<1.0	6/17/2021	-	-	-	None	Locked Door	-	-
1003-01	Girl's Bathroom by Main Office Left	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1003-02	Girl's Bathroom by Main Office Left Middle	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1003-03	Girl's Bathroom by Main Office Right Middle	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1003-04	Girl's Bathroom by Main Office Right	SK	App	21.5	6/17/2021				Additional Sampling Required			
1004-01	Principa's Office Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2001-01	Boy's Bathroom by Teacher's Lounge Left	SK	App	2.85	6/17/2021	-	-	-	None	-	-	-
2001-02	Boy's Bathroom by Teacher's Lounge Left Middle	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2001-03	Boy's Bathroom by Teacher's Lounge Right Middle	SK	App	1.36	6/17/2021	-	-	-	None	-	-	-
2001-04	Boy's Bathroom by Teacher's Lounge Right	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2002-01	Custodial Closet by Teacher's Lounge	SS	N/A		6/17/2021	-	-	-	None	Locked Door	-	-
2003-01	Girl's Bathroom by Teacher's Lounge Left	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2003-02	Girl's Bathroom by Teacher's Lounge Left Middle	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2003-03	Girl's Bathroom by Teacher's Lounge Right Middle	SK	App	6.87	6/17/2021	-	-	-	None	-	-	-
2003-04	Girl's Bathroom by Teacher's Lounge Right	SK	App	4.04	6/17/2021	-	-	-	None	-	-	-
2004-01	Teacher's Lounge Bathroom	SK	App	1.83	6/17/2021	-	-	-	None	-	-	-
2005-01	Nurse's Office Bathroom	SK	App	7.27	6/17/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212807-18244

June 21, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Front Street School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 17, 2021. New York Environmental analyzed the samples on June 18, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	17 Jun 2021
Date Received:	17 Jun 2021
Date Analyzed:	18 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210617Q136	1	Kitchen 3-Bay Left-SK; Initial	1.00	<1.00	µg/L	
210617Q137	2	Kitchen 3-Bay Middle-SK; Initial	1.00	5.14	µg/L	
210617Q138	3	Kitchen 3-Bay Right-SK; Initial	1.00	1.99	µg/L	
210617Q139	4	Women's Faculty Bathroom by Cafeteria Left-SK; Initial	1.00	<1.00	µg/L	
210617Q140	5	Women's Faculty Bathroom by Cafeteria Left Middle-SK; Initial	1.00	<1.00	µg/L	
210617Q141	6	Women's Faculty Bathroom by Cafeteria Right Middle-SK; Initial	1.00	<1.00	µg/L	
210617Q142	7	Women's Faculty Bathroom by Cafeteria Right-SK; Initial	1.00	<1.00	µg/L	
210617Q143	8	Men's Faculty Bathroom by Cafeteria Left-SK; Initial	1.00	15.3	µg/L	H
210617Q144	9	Men's Faculty Bathroom by Cafeteria Left Middle-SK; Initial	1.00	3.99	µg/L	
210617Q145	10	Men's Faculty Bathroom by Cafeteria Right Middle-SK; Initial	1.00	19.1	µg/L	H
210617Q146	11	Men's Faculty Bathroom by Cafeteria Right-SK; Initial	1.00	2.24	µg/L	
210617Q147	12	Principal's Office Bathroom-SK; Initial	1.00	<1.00	µg/L	
210617Q148	13	Boy's Bathroom by Main Office Left-SK; Initial	1.00	<1.00	µg/L	
210617Q149	14	Boy's Bathroom by Main Office Left Middle-SK; Initial	1.00	<1.00	µg/L	
210617Q150	15	Boy's Bathroom by Main Office Right Middle-SK; Initial	1.00	<1.00	µg/L	
210617Q151	16	Boy's Bathroom by Main Office Right-SK; Initial	1.00	<1.00	µg/L	
210617Q152	17	Girl's Bathroom by Main Office Left-SK; Initial	1.00	<1.00	µg/L	
210617Q153	18	Girl's Bathroom by Main Office Left Middle-SK; Initial	1.00	<1.00	µg/L	
210617Q154	19	Girl's Bathroom by Main Office Right Middle-SK; Initial	1.00	<1.00	µg/L	
210617Q155	20	Girl's Bathroom by Main Office Right-SK; Initial	1.00	21.5	µg/L	H
210617Q156	21	Boy's Bathroom by Teacher's Lounge Left-SK; Initial	1.00	2.85	µg/L	
210617Q157	22	Boy's Bathroom by Teacher's Lounge Left Middle-SK; Initial	1.00	<1.00	µg/L	
210617Q158	23	Boy's Bathroom by Teacher's Lounge Right Middle-SK; Initial	1.00	1.36	µg/L	
210617Q159	24	Boy's Bathroom by Teacher's Lounge Right-SK; Initial	1.00	<1.00	µg/L	
210617Q160	25	Girl's Bathroom by Teacher's Lounge Left-SK; Initial	1.00	<1.00	µg/L	
210617Q161	26	Girl's Bathroom by Teacher's Lounge Left Middle-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	17 Jun 2021
Date Received:	17 Jun 2021
Date Analyzed:	18 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210617Q162	27	Girl's Bathroom by Teacher's Lounge Right Middle-SK; Initial	1.00	6.87	µg/L	
210617Q163	28	Girl's Bathroom by Teacher's Lounge Right-SK; Initial	1.00	4.04	µg/L	
210617Q164	29	Teacher's Lounge Bathroom-SK; Initial	1.00	1.83	µg/L	
210617Q165	30	Nurse's Office Bathroom-SK; Initial	1.00	7.27	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Appendix E

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1002-1	Boys Bathroom	SK	App	1.26	6/17/2021	-	-	-	None	-	-	-
1003-1	Girls Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1004-1	Faculty Room 7	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1004-2	Faculty Room 7	WF	App		6/17/2021	-	-	-	None	Removed From Service	-	-
1005-1	Hall near Room 7	WF	App		6/17/2021	-	-	-	None	Removed From Service	-	-
1005-2	Hall near Room 7	BF	App		6/17/2021	-	-	-	None	Removed From Service	-	-
1006-1	Room 5 Multipurpose	SK	App	1.12	6/17/2021	-	-	-	None	-	-	-
1007-1	Room 6	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1008-1	Nurses Office	SK	App	1.87	6/17/2021	-	-	-	None	-	-	-
1009-1	Main Office Kitchenette	SK	App	3.5	6/17/2021	-	-	-	None	-	-	-
1010-1	Main Office Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1011-1	Room 1	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1011-2	Room 1	WF	App		6/17/2021	-	-	-	None	Removed From Service	-	-
1012-1	Hall near Room 4	BF	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1012-2	Hall near Room 4	WF	App		6/17/2021	-	-	-	None	Removed From Service	-	-
1013-1	Room 2	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1013-2	Room 2	WF	App		6/17/2021	-	-	-	None	Removed From Service	-	-
1014-1	Room 3	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1014-2	Room 3	WF	App		6/17/2021	-	-	-	None	Removed From Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1015-1	Room 4	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1015-2	Room 4	WF	App		6/17/2021	-	-	-	None	Removed From Service	-	-
1016-1	Portable A/B Bathroom	SK	App	3	6/17/2021	-	-	-	None	-	-	-
1017-1	Portable C Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1018-1	Portable D Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1019-1	Portable E Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1020-1	Portable F Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1021-1	Portable G Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1022-1	Portable H Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1027-1	Portable M Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1028-1	Portable N Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1029-1	Portable O Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1030-1	Portable P Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1025-1	Portable K Bathroom	SK	App	1.84	6/17/2021	-	-	-	None	-	-	-
1026-1	Portable L Bathroom	SK	App	2.56	6/17/2021	-	-	-	None	-	-	-
1023-1	Portable I Bathroom	SK	App	1.76	6/17/2021	-	-	-	None	-	-	-
1024-1	Portable J Bathroom	SK	App	1.47	6/17/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212822-18257

June 23, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Jackson Annex School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 18, 2021. New York Environmental analyzed the samples on June 21, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	17 Jun 2021
Date Received:	18 Jun 2021
Date Analyzed:	21 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210618L082	1	Kitchen-SK; Initial	1.00	<1.00	µg/L	
210618L083	2	Boys Bathroom-SK; Initial	1.00	1.26	µg/L	
210618L084	3	Girls Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L085	4	Faculty Room 7-SK; Initial	1.00	<1.00	µg/L	
210618L086	5	Room 5 Multipurpose-SK; Initial	1.00	1.12	µg/L	
210618L087	6	Room 6-SK; Initial	1.00	<1.00	µg/L	
210618L088	7	Nurses Office-SK; Initial	1.00	1.87	µg/L	
210618L089	8	Main Office Kitchenette-SK; Initial	1.00	3.50	µg/L	
210618L090	9	Main Office Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L091	10	Room 1-SK; Initial	1.00	<1.00	µg/L	
210618L092	11	Hall near Room 4-BF; Initial	1.00	<1.00	µg/L	
210618L093	12	Room 2-SK; Initial	1.00	<1.00	µg/L	
210618L094	13	Room 3-SK; Initial	1.00	<1.00	µg/L	
210618L095	14	Room 4-SK; Initial	1.00	<1.00	µg/L	
210618L096	15	Portable A/B Bathroom-SK; Initial	1.00	3.00	µg/L	
210618L097	16	Portable C Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L098	17	Portable D Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L099	18	Portable E Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L100	19	Portable F Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L101	20	Portable G Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L102	21	Portable H Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L103	22	Portable M Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L104	23	Portable N Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L105	24	Portable O Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L106	25	Portable P Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L107	26	Portable K Bathroom-SK; Initial	1.00	1.84	µg/L	



Date Collected:	17 Jun 2021
Date Received:	18 Jun 2021
Date Analyzed:	21 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210618L108	27	Portable L Bathroom-SK; Initial	1.00	2.56	µg/L	
210618L109	28	Portable I Bathroom-SK; Initial	1.00	1.76	µg/L	
210618L110	29	Portable J Bathroom-SK; Initial	1.00	1.47	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix F

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1002-1	Room 10	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1003-1	Hall near Room 11	BF	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1004-1	Boys Bathroom by Room 11 (Left)	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1004-2	Boys Bathroom by Room 11 (Right)	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1005-1	Girls Bathroom by Room 11 (Left)	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1005-2	Girls Bathroom by Room 11 (Right)	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1006-1	Hall near Room 19	WF	App		6/17/2021	-	-	-	None	Removed From Service	-	-
1006-2	Hall near Room 19	BF	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1007-1	Custodial Closet	SS	N/A		6/17/2021	-	-	-	None	Locked Door	-	-
1008-1	Room 14	SK	App	6.07	6/17/2021	-	-	-	None	-	-	-
1009-1	Room 18	SK	App	28.7	6/17/2021				Additional Sampling Required			
1010-1	Mens Bathroom near Conference Room	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1011-1	Womens Bathroom near Conference Room	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1012-1	Nurses Office Bathroom	SK	App	2.5	6/17/2021	-	-	-	None	-	-	-
1013-1	Main Office Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1015-1	Girls Bathroom by Room 4 (Left)	SK	App	1.09	6/17/2021	-	-	-	None	-	-	-
1015-2	Girls Bathroom by Room 4 (Right)	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1014-1	Custodial Closet near Attendance Office	SS	N/A		6/17/2021	-	-	-	None	Locked Door	-	-
1016-1	Hall near Room 6	WF	App		6/17/2021	-	-	-	None	Removed From Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1016-2	Hall near Room 6	BF	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1017-1	Boys Bathroom by Room 6 (Left)	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1017-2	Boys Bathroom by Room 6 (Right)	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1018-1	Room 8 Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1019-1	Room 8-B	SK	App	1.08	6/17/2021	-	-	-	None	-	-	-
1020-1	Boiler Room	SS	N/A		6/17/2021	-	-	-	None	Locked Door	-	-
1021-1	Portable D Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1022-1	Portable C Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1023-1	Portable B Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1024-1	Portable A Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212820-18255

June 23, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Jackson Main School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 18, 2021. New York Environmental analyzed the samples on June 21, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	17 Jun 2021
Date Received:	18 Jun 2021
Date Analyzed:	21 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210618L010	1	Kitchen-SK; Initial	1.00	<1.00	µg/L	
210618L011	2	Room 10-SK; Initial	1.00	<1.00	µg/L	
210618L012	3	Hall near Room 11-BF; Initial	1.00	<1.00	µg/L	
210618L013	4	Boys Bathroom (Left)-SK; Initial	1.00	<1.00	µg/L	
210618L014	5	Boys Bathroom (Right)-SK; Initial	1.00	<1.00	µg/L	
210618L015	6	Girls Bathroom (Left)-SK; Initial	1.00	<1.00	µg/L	
210618L016	7	Girls Bathroom (Right)-SK; Initial	1.00	1.65	µg/L	
210618L017	8	Hall near Room 19-BF; Initial	1.00	<1.00	µg/L	
210618L018	9	Room 14-SK; Initial	1.00	6.07	µg/L	
210618L019	10	Room 18-SK; Initial	1.00	28.7	µg/L	H
210618L020	11	Mens Bathroom near Conference Room-SK; Initial	1.00	<1.00	µg/L	
210618L021	12	Womens Bathroom near Conference Room-SK; Initial	1.00	<1.00	µg/L	
210618L022	13	Nurses Office Bathroom-SK; Initial	1.00	2.50	µg/L	
210618L023	14	Main Office Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L024	15	Girls Bathroom (Left)-SK; Initial	1.00	1.09	µg/L	
210618L025	16	Girls Bathroom (Right)-SK; Initial	1.00	<1.00	µg/L	
210618L026	17	Hall near Room 6-WF; Initial	1.00	<1.00	µg/L	
210618L027	18	Boys Bathroom (Left)-SK; Initial	1.00	<1.00	µg/L	
210618L028	19	Boys Bathroom (Right)-SK; Initial	1.00	<1.00	µg/L	
210618L029	20	Room 8 Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L030	21	Room 8-B-SK; Initial	1.00	1.08	µg/L	
210618L031	22	Portable D-SK; Initial	1.00	<1.00	µg/L	
210618L032	23	Portable C-SK; Initial	1.00	<1.00	µg/L	
210618L033	24	Portable B-SK; Initial	1.00	<1.00	µg/L	
210618L034	25	Portable A-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	17 Jun 2021
Date Received:	18 Jun 2021
Date Analyzed:	21 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID **CID** **Sample Location/Description** **LOQ** **Result** **Units** **Flag**

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.



Appendix G

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen 2 Bay	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1002-1	Hall by Cafetorium	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
1002-2	Hall by Cafetorium	BF	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1003-1	ADA Accessible Bathroom by Cafetorium	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1004-1	Boys Bathroom by Cafetorium (Left)	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1004-2	Boys Bathroom by Cafetorium (Right)	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
1005-1	Room 31	SK	App	2.05	6/16/2020	-	-	-	None	-	-	-
1006-1	Room 32	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
1006-2	Room 32	SK	App	7.68	6/16/2020	-	-	-	None	-	-	-
1007-1	Girls Bathroom by Room 32 (Left)	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
1007-2	Girls Bathroom by Room 32 (Right)	SK	App	3.41	6/16/2020	-	-	-	None	-	-	-
1008-1	Custodial Closet by Room 32	SS	N/A		6/16/2020	-	-	-	None	Locked door	-	-
1009-1	Room 33	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
1009-2	Room 33	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
1010-1	Room 35	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
1010-2	Room 35	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
1011-1	Faculty Lounge 38A	SK	App	21	6/16/2020				Additional Sampling Required			
1012-1	Room 36	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
1012-2	Room 36	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
1013-1	Room 37	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1013-2	Room 37	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
2001-1	Room 42	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
2001-2	Room 42	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
2002-1	Room 41	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
2002-2	Room 41	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
2003-1	Room 40	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
2003-2	Room 40	SK	App	264	6/16/2020				Additional Sampling Required			
2004-1	Room 39	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
2004-2	Room 39	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
2005-1	Boys Bathroom by Room 38 (Left)	SK	App	35.5	6/16/2020				Additional Sampling Required			
2005-2	Boys Bathroom by Room 38 (Right)	SK	App	6.07	6/16/2020	-	-	-	None	-	-	-
2006-1	Custodial Closet by Room 38	SS	N/A		6/16/2020	-	-	-	None	Locked door	-	-
2007-1	Girls Bathroom by Room 38 (Left)	SK	App	3.16	6/16/2020	-	-	-	None	-	-	-
2007-2	Girls Bathroom by Room 38 (Right)	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
2008-1	Room 38	WF	App	216	6/16/2020				Additional Sampling Required			
2008-2	Room 38	SK	App	171	6/16/2020				Additional Sampling Required			
1014-1	Custodial Closet by Room 29	SS	N/A		6/16/2020	-	-	-	None	Locked door	-	-
1015-1	Girls Bathroom by Room 29 (Left)	SK	App	1.81	6/16/2020	-	-	-	None	-	-	-
1015-2	Girls Bathroom by Room 29 (Right)	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1016-1	Room 28 Bathroom	SK	App	1.99	6/16/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1017-1	Room 27B	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
1017-2	Room 27B	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
1017-3	Room 27B Bathroom	SK	App	10.1	6/16/2020	-	-	-	None	-	-	-
1018-1	Boys Bathroom by Room 21 (Left)	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1018-2	Boys Bathroom by Room 21 (Right)	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
1019-1	Girls Bathroom by Room 11 (Left)	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1019-2	Girls Bathroom by Room 11 (Right)	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1019-3	Girls Bathroom by Room 11	SS	N/A		6/16/2020	-	-	-	Sign Required	-	-	-
1020-1	Faculty Lounge Room 10	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1021-1	Boys Bathroom by Room 6	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1021-2	Boys Bathroom by Room 6 Custodial Closet	SS	N/A		6/16/2020	-	-	-	Sign Required	-	-	-
1022-1	Hall by Room 4	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
1023-1	Nurses Office Bathroom	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1024-1	Hall by Nurses Office	WF	App		6/16/2020	-	-	-	None	Removed from service	-	-
1025-1	Girls Bathroom by Room 25 (Left)	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-
1025-2	Girls Bathroom by Room 25 (Right)	SK	App		6/16/2020	-	-	-	None	Removed from service	-	-
1026-1	ESL Room 26 Storage Closet	SK	App	201	6/16/2020				Additional Sampling Required			
1027-1	Portable 3 Bathroom	SK	App	5.75	6/16/2020	-	-	-	None	-	-	-
1028-1	Portable 4 Bathroom	SK	App	<1.0	6/16/2020	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212804-18241

June 21, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Joseph A. Mcneil Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 17, 2021. New York Environmental analyzed the samples on June 18, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	16 Jun 2021
Date Received:	17 Jun 2021
Date Analyzed:	18 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210617Q097	1	Kitchen 2 Bay-SK; Initial	1.00	<1.00	µg/L	
210617Q098	2	Hall by Cafetorium-BF; Initial	1.00	<1.00	µg/L	
210617Q099	3	ADA Accessible Bathroom by Cafetorium-SK; Initial	1.00	<1.00	µg/L	
210617Q100	4	Boys Bathroom by Cafetorium (Left)-SK; Initial	1.00	<1.00	µg/L	
210617Q101	5	Room 31-SK; Initial	1.00	2.05	µg/L	
210617Q102	6	Room 32-SK; Initial	1.00	7.68	µg/L	
210617Q103	7	Girls Bathroom by Room 32 (Right)-SK; Initial	1.00	3.41	µg/L	
210617Q104	8	Faculty Lounge 38A-SK; Initial	1.00	21.0	µg/L	H
210617Q105	9	Room 40-SK; Initial	1.00	264	µg/L	E,H
210617Q106	10	Boys Bathroom by Room 38 (Left)-SK; Initial	1.00	35.5	µg/L	H
210617Q107	11	Boys Bathroom by Room 38 (Right)-SK; Initial	1.00	6.07	µg/L	
210617Q108	12	Girls Bathroom by Room 38 (Left)-SK; Initial	1.00	3.16	µg/L	
210617Q109	13	Girls Bathroom by Room 38 (Right)-SK; Initial	1.00	<1.00	µg/L	
210617Q110	14	Room 38-WF; Initial	1.00	216	µg/L	E,H
210617Q111	15	Room 38-SK; Initial	1.00	171	µg/L	E,H
210617Q112	16	Girls Bathroom by Room 29 (Left)-SK; Initial	1.00	1.81	µg/L	
210617Q113	17	Girls Bathroom by Room 29 (Right)-SK; Initial	1.00	<1.00	µg/L	
210617Q114	18	Room 28 Bathroom-SK; Initial	1.00	1.99	µg/L	
210617Q115	19	Room 27B Bathroom-SK; Initial	1.00	10.1	µg/L	
210617Q116	20	Boys Bathroom by Room 21 (Left)-SK; Initial	1.00	<1.00	µg/L	
210617Q117	21	Girls Bathroom by Room 11 (Left)-SK; Initial	1.00	<1.00	µg/L	
210617Q118	22	Girls Bathroom by Room 11 (Right)-SK; Initial	1.00	<1.00	µg/L	
210617Q119	23	Faculty Lounge Room 10-SK; Initial	1.00	<1.00	µg/L	
210617Q120	24	Boys Bathroom by Room 6-SK; Initial	1.00	<1.00	µg/L	
210617Q121	25	Nurses Office Bathroom-SK; Initial	1.00	<1.00	µg/L	
210617Q122	26	Girls Bathroom by Room 25 (Left)-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	16 Jun 2021
Date Received:	17 Jun 2021
Date Analyzed:	18 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210617Q123	27	ESL Room 26 Storage Closet-SK; Initial	1.00	201	µg/L	E,H
210617Q124	28	Portable 3 Bathroom-SK; Initial	1.00	5.75	µg/L	
210617Q125	29	Portable 4 Bathroom-SK; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix H

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-01	Custodial Closet by Elevator	SS	N/A		6/17/2021	-	-	-	None	Locked Door	-	-
0002-01	Right Unisex Bathroom by Elevator Left	SK	App	2.36	6/17/2021	-	-	-	None	-	-	-
0003-01	Left Unisex Bathroom by Elevator Right	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
0004-01	Room L8	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
0004-02	Room L8	WF	App	4.49	6/17/2021	-	-	-	None	-	-	-
0005-01	Hall by Room L8 Left	WF	App	<1.0	6/17/2021	-	-	-	None	-	-	-
0005-02	Hall by Room L8 Right	WF	App	1.68	6/17/2021	-	-	-	None	-	-	-
0006-01	Room L2	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
0006-02	Room L2	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
0007-01	Room L9	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
0007-02	Room L9	WF	App	3.82	6/17/2021	-	-	-	None	-	-	-
0008-01	Custodial Office Break Room	SK	App		6/17/2021	-	-	-	None	-	-	-
1001-01	Kitchen Handwash	SK	N/A		6/17/2021	-	-	-	Sign Required	-	-	-
1001-02	Kitchen 3-Bay Left	SK	App	1.35	6/17/2021	-	-	-	None	-	-	-
1001-03	Kitchen 3-Bay Right	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1001-04	Kitchen Serving Line Handwash	SK	N/A		6/17/2021	-	-	-	Sign Required	-	-	-
1001-05	Kitchen Serving Line Prep	SK	App	17.3	6/17/2021				Additional Sampling Required			
1002-01	Hall by Room 14 Left	WF	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1002-02	Hall by Room 14 Right	WF	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1003-01	Custodial Closet by Room 14	SS	N/A		6/17/2021	-	-	-	None	Locked Door	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1004-01	Room 19	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1004-02	Room 19	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1005-01	Room 18	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1005-02	Room 18	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1006-01	Room 17	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1006-02	Room 17	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1007-01	Room 16	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1007-02	Room 16	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1008-01	Room 15	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1008-02	Room 15	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1009-01	Room 14	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1009-02	Room 14	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1010-01	Girl's Bathroom by Cafeteria Left	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1010-02	Girl's Bathroom by Cafeteria Right	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1011-01	Boy's Bathroom by Cafeteria Left	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1011-02	Boy's Bathroom by Cafeteria Right	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1012-01	Nurse's Office Bathroom	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1012-02	Nurse's Office	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1013-01	Room 4	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1013-02	Room 4	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1014-01	Room 5	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1014-02	Room 5	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1015-01	Unisex Bathroom by Room 5	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1016-01	Room 3	SK	App	35.1	6/17/2021				Additional Sampling Required			
1016-02	Room 3	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1017-01	Principal's Office Bathroom	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1017-02	Girl's Bathroom by Main Office Left	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1017-03	Girl's Bathroom by Main Office Middle	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1018-01	Girl's Bathroom by Main Office Right	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1019-01	Custodial Closet by Main Office	SS	N/A		6/17/2021	-	-	-	None	Locked Door	-	-
1019-02	Hall by Room 8 Left	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1020-01	Hall by Room 8 Right	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1021-01	Room 8	SK	App	11.6	6/17/2021	-	-	-	None	-	-	-
1021-02	Room 8	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1022-01	Room 13	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1022-02	Room 13	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1023-01	Room 12	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1023-02	Room 12	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1024-01	Faculty Room 9	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1025-01	Men's Bathroom by Faculty Room 9	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1026-01	Room 10	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1026-02	Room 10	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
1027-01	Room 11	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
1027-02	Room 11	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
2001-01	Room 27	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2001-02	Room 27	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
2002-01	Room 26	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2002-02	Room 26	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
2003-01	Unisex Bathroom by Room 26	SK	App		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2004-01	Room 28	SK	App	1.27	6/17/2021	-	-	-	None	-	-	-
2004-02	Room 28	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
2005-01	Room 24	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2005-02	Room 24	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
2006-01	Room 31	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2006-02	Room 31	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
2007-01	Boy's Bathroom by Room 31 Left	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2007-02	Boy's Bathroom by Room 31 Middle	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2007-03	Boy's Bathroom by Room 31 Right	SK	N/A		6/17/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2008-01	Custodial Closet by Room 22	SS	N/A		6/17/2021	-	-	-	None	Locked Door	-	-
2009-01	Hall by Room 22 Left	WF	App	1.89	6/17/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2009-02	Hall by Room 22 Right	WF	App	4.22	6/17/2021	-	-	-	None	-	-	-
2010-01	Room 22	SK	App	4.07	6/17/2021	-	-	-	None	-	-	-
2010-02	Room 22	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
2011-01	Room 32	SK	App	3.64	6/17/2021	-	-	-	None	-	-	-
2011-02	Room 32	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-
2012-01	Room 33	SK	App	2.42	6/17/2021	-	-	-	None	-	-	-
2012-02	Room 33	WF	App	48.4	6/17/2021				Additional Sampling Required			
2013-01	Men's Bathroom by Office 21	SK	App	1.82	6/17/2021	-	-	-	None	-	-	-
2014-01	Room 34	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2014-02	Room 34	WF	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2015-01	Room 20	SK	App	3.22	6/17/2021	-	-	-	None	-	-	-
2015-02	Room 20	WF	App		6/17/2021	-	-	-	None	Removed from Service	-	-

Laboratory Report

NYE Report #: 2212821-18256

June 23, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Prospect School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 18, 2021. New York Environmental analyzed the samples on June 21, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	17 Jun 2021
Date Received:	18 Jun 2021
Date Analyzed:	21 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210618L035	1	Kitchen 3-Bay Left-SK; Initial	1.00	1.35	µg/L	
210618L036	2	Kitchen 3-Bay Right-SK; Initial	1.00	<1.00	µg/L	
210618L037	3	Kitchen Serving Line Prep-SK; Initial	1.00	17.3	µg/L	H
210618L038	4	Hall by Room 14 Left-WF; Initial	1.00	<1.00	µg/L	
210618L039	5	Hall by Room 14 Right-WF; Initial	1.00	<1.00	µg/L	
210618L040	6	Room 19-SK; Initial	1.00	<1.00	µg/L	
210618L041	7	Room 18-SK; Initial	1.00	<1.00	µg/L	
210618L042	8	Room 17-SK; Initial	1.00	<1.00	µg/L	
210618L043	9	Room 16-SK; Initial	1.00	<1.00	µg/L	
210618L044	10	Room 15-SK; Initial	1.00	<1.00	µg/L	
210618L045	11	Room 14-SK; Initial	1.00	<1.00	µg/L	
210618L046	12	Right Unisex Bathroom by Elevator Left-SK; Initial	1.00	2.36	µg/L	
210618L047	13	Left Unisex Bathroom by Elevator Right-SK; Initial	1.00	<1.00	µg/L	
210618L048	14	Room L8-SK; Initial	1.00	<1.00	µg/L	
210618L049	15	Room L8-WF; Initial	1.00	4.49	µg/L	
210618L050	16	Hall by Room L8 Left-WF; Initial	1.00	<1.00	µg/L	
210618L051	17	Hall by Room L8 Right-WF; Initial	1.00	1.68	µg/L	
210618L052	18	Room L2-SK; Initial	1.00	<1.00	µg/L	
210618L053	19	Room L9-SK; Initial	1.00	<1.00	µg/L	
210618L054	20	Room L9-WF; Initial	1.00	3.82	µg/L	
210618L055	21	Custodial Office Break Room- SK;Initial	1.00	<1.00	µg/L	
210618L056	22	Nurse's Office Bathroom-SK; Initial	1.00	<1.00	µg/L	
210618L057	23	Nurse's Office-SK; Initial	1.00	<1.00	µg/L	
210618L058	24	Room 4-SK; Initial	1.00	<1.00	µg/L	
210618L059	25	Room 5-SK; Initial	1.00	<1.00	µg/L	
210618L060	26	Room 3-SK; Initial	1.00	35.1	µg/L	H



Date Collected:	17 Jun 2021
Date Received:	18 Jun 2021
Date Analyzed:	21 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210618L061	27	Room 8-SK; Initial	1.00	11.6	µg/L	
210618L062	28	Room 13-SK; Initial	1.00	<1.00	µg/L	
210618L063	29	Room 12-SK; Initial	1.00	<1.00	µg/L	
210618L064	30	Faculty Room 9-SK; Initial	1.00	<1.00	µg/L	
210618L065	31	Room 10-SK; Initial	1.00	<1.00	µg/L	
210618L066	32	Room 11-SK; Initial	1.00	<1.00	µg/L	
210618L067	33	Room 27-SK; Initial	1.00	<1.00	µg/L	
210618L068	34	Room 26-SK; Initial	1.00	<1.00	µg/L	
210618L069	35	Room 28-SK; Initial	1.00	1.27	µg/L	
210618L070	36	Room 24-SK; Initial	1.00	<1.00	µg/L	
210618L071	37	Room 31-SK; Initial	1.00	<1.00	µg/L	
210618L072	38	Hall by Room 22 Left-WF; Initial	1.00	1.89	µg/L	
210618L073	39	Hall by Room 22 Right-WF; Initial	1.00	4.22	µg/L	
210618L074	40	Room 22-SK; Initial	1.00	4.07	µg/L	
210618L075	41	Room 32-SK; Initial	1.00	3.64	µg/L	
210618L076	42	Room 33-SK; Initial	1.00	2.42	µg/L	
210618L077	43	Room 33-WF; Initial	1.00	48.4	µg/L	H
210618L078	44	Men's Bathroom by Office 21-SK; Initial	1.00	1.82	µg/L	
210618L079	45	Room 34-SK; Initial	1.00	<1.00	µg/L	
210618L080	46	Room 34-WF; Initial	1.00	<1.00	µg/L	
210618L081	47	Room 20-SK; Initial	1.00	3.22	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.



Appendix I

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Bathroom	SK	App	10.7	6/16/2021	-	-	-	None	-	-	-
1001-2	Kitchen Slop Sink	SS	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1001-3	Kitchen 2-Bay Prep sink	SK	App	1.66	6/16/2021	-	-	-	None	-	-	-
1001-4	Kitchen Pot Filler	SK	App	10.5	6/16/2021	-	-	-	None	-	-	-
1001-5	Kitchen 2-Bay by Ovens (left)	SK	App	2.42	6/16/2021	-	-	-	None	-	-	-
1001-6	Kitchen 2-Bay by Ovens (right)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1001-7	Kitchen Handwash	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1002-1	Hall by Room 147	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
1002-2	Hall by Room 147	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1003-1	Boy's Locker Room bathroom (left)	SK	App	14.7	6/16/2021	-	-	-	None	-	-	-
1003-2	Boy's Locker Room bathroom (left center)	SK	App		6/16/2021	-	-	-	None	Removed from service	-	-
1003-3	Boy's Locker Room bathroom (right center)	SK	App	2.54	6/16/2021	-	-	-	None	-	-	-
1003-4	Boy's Locker Room bathroom (right)	SK	App	4.98	6/16/2021	-	-	-	None	-	-	-
1003-5	Boy's Locker Room	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
1004-1	Room 140 Home Economics by door	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1004-2	Room 140 Home Economics (center right)	SK	App	1.27	6/16/2021	-	-	-	None	-	-	-
1004-3	Room 140 Home Economics (center left)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1004-4	Room 140 Home Economics (rear)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1005-1	Hall by Room 150	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
1005-2	Hall by Room 150	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1006-1	Custodial Closet by Room 150	SS	N/A		6/16/2021	-	-	-	None	Locked Door	-	-
1007-1	Faculty Lounge	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1008-1	Women's Bathroom by Faculty Lounge (left)	SK	App	1.37	6/16/2021	-	-	-	None	-	-	-
1008-2	Women's Bathroom by Faculty Lounge (right)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1009-1	Men's Bathroom by Faculty Lounge (left)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1009-2	Men's Bathroom by Faculty Lounge (right)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1010-1	Administration Kitchenette	SK	App	1.38	6/16/2021	-	-	-	None	-	-	-
1011-1	Girl's Bathroom by Lobby (left)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1011-2	Girl's Bathroom by Lobby (center)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1011-3	Girl's Bathroom by Lobby (right)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1012-1	Custodial Closet by Lobby	SS	N/A		6/16/2021	-	-	-	None	Locked Door	-	-
1013-1	Boy's Bathroom by Lobby (left)	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required		-	-
1013-2	Boy's Bathroom by Lobby (right)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1014-1	Staff Bathroom by Lobby (left)	SK	App	19.2	6/16/2021				Additional Sampling Required			
1014-2	Staff Bathroom by Lobby (right)	SK	App		6/16/2021	-	-	-	None	-	-	-
1015-1	Nurse's Office	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1015-2	Nurse's Office Right Bathroom	SK	App	2.9	6/16/2021	-	-	-	None	-	-	-
1015-3	Nurse's Office left Bathroom	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1016-1	Conference Room Bathroom	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1017-1	Principal's Office Bathroom	SK	App	1.37	6/16/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1018-1	Room 132	SK	App	1.12	6/16/2021	-	-	-	None	-	-	-
1019-1	Room 126 Teacher's Station	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1019-2	Counter 1	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1019-3	Counter 2	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1020-1	Hall by Room 126	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
1020-2	Hall by Room 126	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1021-1	Men's Bathroom by Room 7022	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1022-1	Women's Bathroom by Room 7022	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1023-1	Boy's Bathroom by Room 7022 @ A	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-2	Boy's Bathroom by Room 7022 @ B	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-3	Boy's Bathroom by Room 7022 @ C	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-4	Boy's Bathroom by Room 7022 @ D	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-5	Boy's Bathroom by Room 7022 @ E	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1024-1	Custodial Closet by Room 7022	SS	N/A		6/16/2021	-	-	-	None	Locked Door	-	-
1025-1	Girl's Bathroom by Room 7022 @ A	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-2	Girl's Bathroom by Room 7022 @ B	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-3	Girl's Bathroom by Room 7022 @ C	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-4	Girl's Bathroom by Room 7022 @ D	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-5	Girl's Bathroom by Room 7022 @ E	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1026-1	Hall by Room 7033	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1026-2	Hall by Room 7033	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1027-1	Room 121 Teacher's Station	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1027-2	Counter 1	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1027-3	Counter 2	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1028-1	Room 124	SK	N/A		6/16/2021	-	-	-	None	Removed from service	-	-
1028-2	Room 124	SK	App		6/16/2021	-	-	-	None	Removed from service	-	-
1029-1	Room 116 Teacher's Station	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1029-2	Counter 1	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1029-3	Counter 2	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1030-1	Room 119	SK	App	39.3	6/16/2021				Additional Sampling Required			
1030-2	Room 119	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
1031-1	Room 111 Teacher's Station	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1031-2	Counter 1	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1031-3	Counter 2	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1032-1	Room 114	SK	App	2.24	6/16/2021	-	-	-	None	-	-	-
1032-2	Room 114	WF	App		6/16/2021	-	-	-	None	Capped	-	-
1033-1	Boy's Bathroom 7033 @ A	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1033-2	Boy's Bathroom 7033 @ B	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1033-3	Boy's Bathroom 7033 @ C	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1033-4	Boy's Bathroom 7033 @ D	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1033-5	Boy's Bathroom 7033 @ E	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1034-1	Custodial Closet 7044	SS	N/A		6/16/2021	-	-	-	None	Locked Door	-	-
1035-1	Girl's Bathroom 7005 @ A	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1035-2	Girl's Bathroom 7005 @ B	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1035-3	Girl's Bathroom 7005 @ C	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1035-4	Girl's Bathroom 7005 @ D	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1035-5	Girl's Bathroom 7005 @ E	SK	N/A		6/16/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1036-1	Hall by Dean's Office	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
1036-2	Hall by Dean's Office	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1037-1	Room 106 Teacher's Station	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1037-2	Counter 1	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1037-3	Counter 2	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1038-1	Room 109	SK	N/A		6/16/2021	-	-	-	None	Removed from service	-	-
1038-2	Room 109	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
1039-1	Room 101 Teacher's Station	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1039-2	Counter 1	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1039-3	Counter 2	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
1040-1	Room 104	SK	N/A		6/16/2021	-	-	-	None	Removed from service	-	-
1040-2	Room 104	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
1041-1	Room 7013 Social Worker	SK	App	5.33	6/16/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1042-1	Library Office	SK	App	4.26	6/16/2021	-	-	-	None	-	-	-
2001-1	Girl's Bathroom by Gym (left)	SK	App		6/16/2021	-	-	-	None	Removed from service	-	-
2001-2	Girl's Bathroom by Gym (center)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
2001-3	Girl's Bathroom by Gym (right)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
2002-1	Boy's Bathroom by Gym (left)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
2002-2	Boy's Bathroom by Gym (center)	SK	App		6/16/2021	-	-	-	None	Removed from service	-	-
2002-3	Boy's Bathroom by Gym (right)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
2003-1	Hall by Room 206	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
2003-2	Hall by Room 206	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-
2004-1	Custodial Closet by Gym	SK	N/A		6/16/2021	-	-	-	None	Locked Door	-	-
2005-1	Room 209 Tech	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
2006-1	Hall by Room 209	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
2006-2	Hall by Room 209	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-
2007-1	Room 207 Tech	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
2008-1	Room 203 Art	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
2009-1	Room 201 Art	SK	N/A		6/16/2021	-	-	-	Sign Required	-	-	-
0001-1	Hall by Girl's Gym (left)	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
0001-2	Hall by Girl's Gym (right)	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
0001-3	Hall by Girl's Gym (right)	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-
0002-1	Girl's Locker Room Bathroom (left)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0002-2	Girl's Locker Room Bathroom (center)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
0002-3	Girl's Locker Room Bathroom (right)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
0003-1	Men's Bathroom by Facilities Office (left)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
0003-2	Men's Bathroom by Facilities Office (right)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
0003-3	Men's Bathroom by Facilities Office (right)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
0004-1	Hall by Facilities Office	WF	App		6/16/2021	-	-	-	None	Removed from service	-	-
0004-2	Hall by Facilities Office	BF	App	<1.0	6/16/2021	-	-	-	None	-	-	-
0005-1	Custodial Closet by Personnel	SS	N/A		6/16/2021	-	-	-	None	Locked Door	-	-
0006-1	Women's Bathroom by Personnel (left)	SK	App	100	6/16/2021				Additional Sampling Required			
0006-2	Women's Bathroom by Personnel (left center)	SK	App	8.55	6/16/2021	-	-	-	None	-	-	-
0006-3	Women's Bathroom by Personnel (right center)	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
0006-4	Women's Bathroom by Personnel (right)	SK	App	3.75	6/16/2021	-	-	-	None	-	-	-
0007-1	Business Office Women's Bathroom (left)	SK	App	8.69	6/16/2021	-	-	-	None	-	-	-
0007-2	Business Office Women's Bathroom (right)	SK	App	19.1	6/16/2021				Additional Sampling Required			
0007-3	Business Office Men's Bathroom (left)	SK	App	208	6/16/2021				Additional Sampling Required			
0007-4	Business Office Men's Bathroom (right)	SK	App	3.98	6/16/2021	-	-	-	None	-	-	-
0007-5	Business Office Kitchen	SK	App	4.38	6/16/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212803-18240

June 21, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: ABGS Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 17, 2021. New York Environmental analyzed the samples on June 18, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	16 Jun 2021
Date Received:	17 Jun 2021
Date Analyzed:	18 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210617Q033	1	Kitchen Bathroom-SK; Initial	1.00	10.7	µg/L	
210617Q034	2	Kitchen 2-Bay Prep sink-SK; Initial	1.00	1.66	µg/L	
210617Q035	3	Kitchen Pot Filler-SK; Initial	1.00	10.5	µg/L	
210617Q036	4	Kitchen 2-Bay by Ovens (left)-SK; Initial	1.00	2.43	µg/L	
210617Q037	5	Kitchen 2-Bay by Ovens (right)-SK; Initial	1.00	<1.00	µg/L	
210617Q038	6	Hall by Room 147-BF; Initial	1.00	<1.00	µg/L	
210617Q039	7	Boy's Locker Room bathroom (left)-SK; Initial	1.00	14.7	µg/L	
210617Q040	8	Boy's Locker Room bathroom (right center)-SK; Initial	1.00	2.54	µg/L	
210617Q041	9	Boy's Locker Room bathroom (right)-SK; Initial	1.00	4.98	µg/L	
210617Q042	10	Room 140 Home Economics by door-SK; Initial	1.00	<1.00	µg/L	
210617Q043	11	Room 140 Home Economics (center right)-SK; Initial	1.00	1.27	µg/L	
210617Q044	12	Room 140 Home Economics (center left)-SK; Initial	1.00	<1.00	µg/L	
210617Q045	13	Room 140 Home Economics (rear)-SK; Initial	1.00	<1.00	µg/L	
210617Q046	14	Hall by Room 150-BF; Initial	1.00	<1.00	µg/L	
210617Q047	15	Faculty Lounge-SK; Initial	1.00	<1.00	µg/L	
210617Q048	16	Women's Bathroom by Faculty Lounge (left)-SK; Initial	1.00	1.37	µg/L	
210617Q049	17	Women's Bathroom by Faculty Lounge (right)-SK; Initial	1.00	<1.00	µg/L	
210617Q050	18	Men's Bathroom by Faculty Lounge (left)-SK; Initial	1.00	<1.00	µg/L	
210617Q051	19	Men's Bathroom by Faculty Lounge (right)-SK; Initial	1.00	<1.00	µg/L	
210617Q052	20	Administration Kitchenette-SK; Initial	1.00	1.38	µg/L	
210617Q053	21	Girl's Bathroom by Lobby (left)-SK; Initial	1.00	<1.00	µg/L	
210617Q054	22	Girl's Bathroom by Lobby (center)-SK; Initial	1.00	<1.00	µg/L	
210617Q055	23	Girl's Bathroom by Lobby (right)-SK; Initial	1.00	<1.00	µg/L	
210617Q056	24	Boy's Bathroom by Lobby (right)-SK; Initial	1.00	<1.00	µg/L	
210617Q057	25	Staff Bathroom by Lobby (left)-SK; Initial	1.00	19.2	µg/L	H
210617Q058	26	Staff Bathroom by Lobby (right)-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	16 Jun 2021
Date Received:	17 Jun 2021
Date Analyzed:	18 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210617Q059	27	Nurse's Office-SK; Initial	1.00	<1.00	µg/L	
210617Q060	28	Nurse's Office Right Bathroom-SK; Initial	1.00	2.90	µg/L	
210617Q061	29	Nurse's Office left Bathroom-SK; Initial	1.00	<1.00	µg/L	
210617Q062	30	Conference Room Bathroom-SK; Initial	1.00	<1.00	µg/L	
210617Q063	31	Principal's Office Bathroom-SK; Initial	1.00	1.37	µg/L	
210617Q064	32	Room 132-SK; Initial	1.00	1.12	µg/L	
210617Q065	33	Hall by Room 126-WF; Initial	1.00	<1.00	µg/L	
210617Q066	34	Men's Bathroom by Room 7022-SK; Initial	1.00	<1.00	µg/L	
210617Q067	35	Women's Bathroom by Room 7022-SK; Initial	1.00	1.73	µg/L	
210617Q068	36	Hall by Room 7033-BF; Initial	1.00	<1.00	µg/L	
210617Q069	37	Room 119-SK; Initial	1.00	39.3	µg/L	H
210617Q070	38	Room 114-SK; Initial	1.00	2.24	µg/L	
210617Q071	39	Hall by Dean's Office-BF; Initial	1.00	<1.00	µg/L	
210617Q072	40	Room 7013 Social Worker-SK; Initial	1.00	5.33	µg/L	
210617Q073	41	Library Office-SK; Initial	1.00	4.26	µg/L	
210617Q074	42	Girl's Bathroom by Gym (center)-SK; Initial	1.00	<1.00	µg/L	
210617Q075	43	Girl's Bathroom by Gym (right)-SK; Initial	1.00	<1.00	µg/L	
210617Q076	44	Boy's Bathroom by Gym (left)-SK; Initial	1.00	2.24	µg/L	
210617Q077	45	Boy's Bathroom by Gym (right)-SK; Initial	1.00	<1.00	µg/L	
210617Q078	46	Hall by Room 206-BF; Initial	1.00	<1.00	µg/L	
210617Q079	47	Hall by Room 209-BF; Initial	1.00	<1.00	µg/L	
210617Q080	48	Hall by Girl's Gym (right)-BF; Initial	1.00	<1.00	µg/L	
210617Q081	49	Girl's Locker Room Bathroom (left)-SK; Initial	1.00	<1.00	µg/L	
210617Q082	50	Girl's Locker Room Bathroom (center)-SK; Initial	1.00	<1.00	µg/L	
210617Q083	51	Girl's Locker Room Bathroom (right)-SK; Initial	1.00	<1.00	µg/L	
210617Q084	52	Men's Bathroom by Facilities Office (left)-SK; Initial	1.00	<1.00	µg/L	
210617Q085	53	Men's Bathroom by Facilities Office (right)-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	16 Jun 2021
Date Received:	17 Jun 2021
Date Analyzed:	18 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210617Q086	54	Men's Bathroom by Facilities Office (right)-SK; Initial	1.00	<1.00	µg/L	
210617Q087	55	Hall by Facilities Office-BF; Initial	1.00	<1.00	µg/L	
210617Q088	56	Women's Bathroom by Personel (left) SK;Initial	1.00	100	µg/L	E,H
210617Q089	57	Women's Bathroom by Personel (left center) SK; Initial	1.00	8.55	µg/L	
210617Q090	58	Women's Bathroom by Personel (right center) SK; Initial	1.00	<1.00	µg/L	
210617Q091	59	Women's Bathroom by Personel (right)-SK; Initial	1.00	3.75	µg/L	
210617Q092	60	Business Office Women's Bathroom (left)-SK; Initial	1.00	8.69	µg/L	
210617Q093	61	Business Office Women's Bathroom (right)-SK; Initial	1.00	19.1	µg/L	H
210617Q094	62	Business Office Men's Bathroom (left)-SK; Initial	1.00	208	µg/L	E,H
210617Q095	63	Business Office Men's Bathroom (right)-SK; Initial	1.00	3.98	µg/L	
210617Q096	64	Business Office Kitchen-SK; Initial	1.00	4.38	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix J

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-01	Art Room 118 Unit Left	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1001-02	Art Room 118 Unit Right	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1001-03	Art Room between A118 & A116	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1002-01	ADA Bathroom by Room A116	SK	App	14.1	6/15/2021	-	-	-	None	-	-	-
1003-01	Art Room 116 Unit 1 Left	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1003-02	Art Room 116 Unit 1 Middle	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1003-03	Art Room 116 Unit 1 Right	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1003-04	Art Room 116 Unit 2 Left	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1003-05	Art Room 116 Unit 2 Middle	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1003-06	Art Room 116 Unit 2 Right	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1004-01	Boy's Bathroom by Room A116 Left	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1004-02	Boy's Bathroom by Room A116 Right	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1005-01	Men's Faculty Bathroom by Room A116 Left	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
1005-02	Men's Faculty Bathroom by Room A116 Middle	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
1005-03	Men's Faculty Bathroom by Room A116 Right	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
1006-01	Custodial Closet by Room A116	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
1007-01	Hall by Room A114	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
1007-02	Hall by Room A114	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1008-01	Lounge between Room A112 and Room A111	SK	App	2.46	6/15/2021	-	-	-	None	-	-	-
1009-01	Room A110	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1010-01	Room A109	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1011-01	Hall by Room A105	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
1011-02	Hall by Room A105	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1012-01	Custodial Closet by Room A103	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
1013-01	Girl's Bathroom by Room A103 Left	SK	App	2.85	6/15/2021	-	-	-	None	-	-	-
1013-02	Girl's Bathroom by Room A103 Middle	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1013-03	Girl's Bathroom by Room A103 Right	SK	App	3.32	6/15/2021	-	-	-	None	-	-	-
1014-01	Women's Faculty Bathroom by Room A103 Left	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
1014-02	Women's Faculty Bathroom by Room A103 Right	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
1015-01	Little Theatre Men's Bathroom Left	SK	App	3.04	6/15/2021	-	-	-	None	-	-	-
1015-02	Little Theatre Men's Bathroom Right	SK	App	1.14	6/15/2021	-	-	-	None	-	-	-
1016-01	Little Theatre Lobby	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
1017-01	Little Theatre Women's Bathroom Left	SK	App	1.66	6/15/2021	-	-	-	None	-	-	-
1017-02	Little Theatre Women's Bathroom Right	SK	App	3.53	6/15/2021	-	-	-	None	-	-	-
1018-01	Room C103 Teacher's Station	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-02	Room C103 Pod 1 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-03	Room C103 Pod 1 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-04	Room C103 Pod 2 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-05	Room C103 Pod 2 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-06	Room C103 Pod 3 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1018-07	Room C103 Pod 3 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-08	Room C103 Pod 4 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-09	Room C103 Pod 4 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-10	Room C103 Pod 5 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-11	Room C103 Pod 5 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-12	Room C103 Pod 6 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-13	Room C103 Pod 6 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-14	Room C103 Pod 7 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1018-15	Room C103 Pod 7 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1019-01	Room C104B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1020-01	Men's Faculty Bathroom by Room C104 Left	SK	App	12.6	6/15/2021	-	-	-	None	-	-	-
1020-02	Men's Faculty Bathroom by Room C104 Right	SK	App	10.4	6/15/2021	-	-	-	None	-	-	-
1021-01	Room C102	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-01	Room C101 Teacher's Station	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-02	Room C101 Pod 1 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-03	Room C101 Pod 1 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-04	Room C101 Pod 2 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-05	Room C101 Pod 2 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-06	Room C101 Pod 3 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-07	Room C101 Pod 3 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1022-08	Room C101 Pod 4 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-09	Room C101 Pod 4 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-10	Room C101 Pod 5 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-11	Room C101 Pod 5 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-12	Room C101 Pod 6 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-13	Room C101 Pod 6 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-14	Room C101 Pod 7 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1022-15	Room C101 Pod 7 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
1023-01	Hall by Room C105B	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
1023-02	Hall by Room C105B	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1024-01	Boy's Bathroom by Room 105B Left	SK	App	1.34	6/15/2021	-	-	-	None	-	-	-
1024-02	Boy's Bathroom by Room 105B Right	SK	App	7.17	6/15/2021	-	-	-	None	-	-	-
1024-03	Boy's Bathroom by Room 105B Custodial Closet	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
1025-01	Room C107	SK	App		6/15/2021	-	-	-	None	Removed From Service	-	-
1025-02	Room C107	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
1026-01	Athletic Trainer Room	IM	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1026-02	Athletic Trainer Room	SK	App	3.03	6/15/2021	-	-	-	None	-	-	-
1027-01	Girl's Bathroom by Nurse's Office Left	SK	App	2.1	6/15/2021	-	-	-	None	-	-	-
1027-02	Girl's Bathroom by Nurse's Office Right	SK	App	1.27	6/15/2021	-	-	-	None	-	-	-
1028-01	Nurse's Station Exam Room 1	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1028-02	Nurse's Station Bathroom	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1028-03	Nurse's Station Exam Room 2	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1028-04	Nurse's Station Office	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1029-01	Girl's Locker Room Custodial Closet	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
1029-02	Girl's Locker Room Bathroom Left	SK	App	2.98	6/15/2021	-	-	-	None	-	-	-
1029-03	Girl's Locker Room Bathroom Right	SK	App	1.04	6/15/2021	-	-	-	None	-	-	-
1029-04	Girl's Locker Room	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
1029-05	Girl's Locker Room Coach's Office Bathroom	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1030-01	Hall by Girl's Locker Room	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
1030-02	Hall by Girl's Locker Room	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1031-01	Girl's Bathroom by Gym Left	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
1031-02	Girl's Bathroom by Gym Middle	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
1031-03	Girl's Bathroom by Gym Right	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
1032-01	Boy's Bathroom by Gym Left	SK	App	5.27	6/15/2021	-	-	-	None	-	-	-
1032-02	Boy's Bathroom by Gym Middle	SK	App	4.34	6/15/2021	-	-	-	None	-	-	-
1032-03	Boy's Bathroom by Gym Right	SK	App	7.51	6/15/2021	-	-	-	None	-	-	-
1033-01	Boy's Locker Room Coach's Office Bathroom	SK	App	4.56	6/15/2021	-	-	-	None	-	-	-
1033-02	Boy's Locker Room Bathroom Left	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1033-03	Boy's Locker Room Bathroom Right	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
1033-04	Boy's Locker Room Bathroom	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1034-01	Custodial Closet by Boy's Locker Room	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
1035-01	Pool Boy's Locker Room	WF	App	3.08	6/15/2021	-	-	-	None	-	-	-
1035-02	Pool Boy's Locker Room Bathroom Left	SK	App	2.47	6/15/2021	-	-	-	None	-	-	-
1035-03	Pool Boy's Locker Room Bathroom Right	SK	App	1.97	6/15/2021	-	-	-	None	-	-	-
1036-01	Athletic Director's Office	SK	App	28.1	6/16/2021				Additional Sampling Required	-	-	-
2001-01	Kitchen Island 2-Bay	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2001-02	Kitchen Island	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2001-03	Kitchen 3-Bay Left	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2001-04	Kitchen 3-Bay Right	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2001-05	Kitchen Potfiller Left	PF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2001-06	Kitchen Potfiller Right	PF	App	1.44	6/15/2021	-	-	-	None	-	-	-
2001-07	Kitchen Island 2	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2001-08	Kitchen Bathroom	SK	App	1.01	6/15/2021	-	-	-	None	-	-	-
2001-09	Kitchen Pizza & Burger Serving Line	SK	App	11.3	6/15/2021	-	-	-	None	-	-	-
2001-10	Kitchen Tiger Deli Serving Line Left	SK	App	5.41	6/15/2021	-	-	-	None	-	-	-
2001-11	Kitchen Tiger Deli Serving Line Right	SK	App	1.26	6/15/2021	-	-	-	None	-	-	-
2002-01	Cafeteria Left	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
2002-02	Cafeteria Left	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2003-01	Cafeteria Right	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
2004-01	Room C203	SK	App	4.76	6/15/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2005-01	Room C202 Handwash	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
2005-02	Room C202 Station 1	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2005-03	Room C202 Station 2	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2005-04	Room C202 Station 3	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2006-01	Room C201	SK	App	1.59	6/15/2021	-	-	-	None	-	-	-
2007-01	Hall by Room C208	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
2007-02	Hall by Room C208	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2008-01	Women's Bathroom by Faculty Room 224 Left	SK	App	1.62	6/15/2021	-	-	-	None	-	-	-
2008-02	Women's Bathroom by Faculty Room 224 Right	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2009-01	Men's Bathroom by Faculty Room C224 Left	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2009-02	Men's Bathroom by Faculty Room C224 Right	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2010-01	Faculty Dining	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2010-02	Faculty Dining Custodial Closet	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
2011-01	Custodial Closet by Guidance	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
2012-01	Women's Bathroom by Pool Left	SK	App	4.96	6/15/2021	-	-	-	None	-	-	-
2012-02	Women's Bathroom by Pool Right	SK	App	2.13	6/15/2021	-	-	-	None	-	-	-
2013-01	Hall by Pool	Wf	App		6/15/2021	-	-	-	None	Removed From Service	-	-
2013-02	Hall by Pool	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2014-01	Men's Bathroom by Pool Left	SK	App	4.99	6/15/2021	-	-	-	None	-	-	-
2014-02	Men's Bathroom by Pool Right	SK	App	2.26	6/15/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2015-01	Pool Girl's Locker Room Custodial Closet	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
2015-02	Pool Girl's Locker Room	WF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2015-03	Pool Girl's Locker Room Bathroom Left	SK	App	1.13	6/15/2021	-	-	-	None	-	-	-
2015-04	Pool Girl's Locker Room Bathroom Right	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2016-01	Pool Swimming Instructor Bathroom	SK	App	3.26	6/15/2021	-	-	-	None	-	-	-
2017-01	Pool Coach's Office	SK	App	5.57	6/15/2021	-	-	-	None	-	-	-
2018-01	Guidance Suite	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
2018-02	Guidance Suite	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2019-01	Main Office Principal's Bathroom	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2020-01	Custodial Closet by Board Room	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
2021-01	Women's Bathroom by Board Room Left	SK	App	1.76	6/15/2021	-	-	-	None	-	-	-
2021-02	Women's Bathroom by Board Room Right	SK	App	3.83	6/15/2021	-	-	-	None	-	-	-
2022-01	Men's Bathroom by Board Room Left	SK	App	9.59	6/15/2021	-	-	-	None	-	-	-
2022-02	Men's Bathroom by Board Room Right	SK	App	2.51	6/15/2021	-	-	-	None	-	-	-
2023-01	ADA Bathroom by Room B201	SK	App	3.64	6/15/2021	-	-	-	None	-	-	-
2024-01	Boy's Bathroom by Room A218 Left	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2024-02	Boy's Bathroom by Room A218 Rigt	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2025-01	Men's Faculty Bathroom by Room A218 Left	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
2025-02	Men's Faculty Bathroom by Room A218 Middle	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
2025-03	Men's Faculty Bathroom by Room A218 Right	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2026-01	Custodial Closet by Room A218	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
2027-01	Hall by Room A217	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
2027-02	Hall by Room A217	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2028-01	Hall by Room A205	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
2028-02	Hall by Room A205	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2029-01	Custodial Closet by Room A202	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
2030-01	Girl's Bathroom by Room A202 Left	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2030-02	Girl's Bathroom by Room A202 Middle	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2030-03	Girl's Bathroom by Room A202 Right	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
2031-01	Women's Faculty Bathroom by Room A202 Left	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
2031-02	Women's Faculty Bathroom by Room A202 Right	SK	N/A		6/15/2021	-	-	-	None	SIGN	-	-
3001-01	Boy's Bathroom by Room A314 Left	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
3001-02	Boy's Bathroom by Room A314 Right	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
3002-01	Men's Bathroom by Room A314 Left	SK	App	18.1	6/15/2021				Additional Sampling Required			
3002-02	Men's Bathroom by Room A314 Middle	SK	App	1.08	6/15/2021	-	-	-	None	-	-	-
3002-03	Men's Bathroom by Room A314 Right	SK	App	5.77	6/15/2021	-	-	-	None	-	-	-
3003-01	Custodial Closet by Room A314	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
3004-01	Hall by Room A313	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
3004-02	Hall by Room A313	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
3005-01	Room A311 Teacher's Station	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3005-02	Room A311 Counter @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3005-03	Room A311 Counter @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3005-04	Room A311 Counter @ C	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3005-05	Room A311 Counter @ D	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3005-06	Room A311 Prep Room	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3006-01	Room A310 Teacher's Station	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3006-02	Room A310 Counter @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3006-03	Room A310 Counter @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3006-04	Room A310 Counter @ C	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3006-05	Room A310 Counter @ D	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3007-01	Room A309 Teacher's Station	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3007-02	Room A309 Counter @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3007-03	Room A309 Counter @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3007-04	Room A309 Counter @ C	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3007-05	Room A309 Counter @ D	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3007-06	Room A309 Counter @ E	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3007-07	Room A309 Counter @ F	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3007-08	Room A309 Counter @ G	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3007-09	Room A309 Counter @ H	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3007-10	Room A309 / A308 Prep Room	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3008-01	Room A308 Teacher's Station	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3008-02	Room A308 Counter @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3008-03	Room A308 Counter @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3008-04	Room A308 Counter @ C	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3008-05	Room A308 Counter @ D	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3008-06	Room A308 Counter @ E	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3008-07	Room A308 Counter @ F	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3008-08	Room A308 Counter @ G	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-01	Room A307 Teacher's Station	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-02	Room A307 Fume Hood 1	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-03	Room A307 Fume Hood 2	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-04	Room A307 Counter	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-05	Room A307 Pod 1 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-06	Room A307 Pod 1 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-07	Room A307 Pod 2 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-08	Room A307 Pod 2 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-09	Room A307 Pod 3 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-10	Room A307 Pod 3 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-11	Room A307 Pod 4 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-12	Room A307 Pod 4 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3009-13	Room A307 Pod 5 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-14	Room A307 Pod 5 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-15	Room A307 Pod 6 @ A	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-16	Room A307 Pod 6 @ B	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3009-17	Room A307 Prep Room	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3010-01	Science Office	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3011-01	Room A306 Teacher's Station	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3011-02	Room A306 Counter	SK	N/A		6/15/2021	-	-	-	Sign Required	-	-	-
3012-01	Hall by Room A305	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
3012-02	Hall by Room A305	BF	App	<1.0	6/15/2021	-	-	-	None	-	-	-
3013-01	Custodial Closet by Room A303	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-
3014-01	Girl's Bathroom by Room A303 Left	SK	App	1.25	6/15/2021	-	-	-	None	-	-	-
3014-02	Girl's Bathroom by Room A303 Middle	SK	App	3.13	6/15/2021	-	-	-	None	-	-	-
3014-03	Girl's Bathroom by Room A303 Right	SK	App	1.75	6/15/2021	-	-	-	None	-	-	-
3015-01	Women's Bathroom by Room A303 Left	SK	App	3.62	6/15/2021	-	-	-	None	-	-	-
3015-02	Women's Bathroom by Room A303 Right	SK	App	2.15	6/15/2021	-	-	-	None	-	-	-
3016-01	Hall by Room B303	WF	App		6/15/2021	-	-	-	None	Removed From Service	-	-
3017-01	ADA Bathroom by Room B308 / Team Center	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
4001-01	Men's Bathroom B410 by JROTC	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-
4002-01	Custodial Closet B412 by JROTC	SS	N/A		6/15/2021	-	-	-	None	Locked Door	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
4003-01	Women's Bathroom by JROTC	SK	App	<1.0	6/15/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212755-18222

June 17, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Hempstead High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 15, 2021. New York Environmental analyzed the samples on June 16, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	15 Jun 2021
Date Received:	15 Jun 2021
Date Analyzed:	16 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210615Q055	1	Kitchen Island 2-Bay-SK; Initial	1.00	<1.00	µg/L	
210615Q056	2	Kitchen Island-SK; Initial	1.00	<1.00	µg/L	
210615Q057	3	Kitchen 3-Bay Left-SK; Initial	1.00	<1.00	µg/L	
210615Q058	4	Kitchen 3-Bay Right-SK; Initial	1.00	<1.00	µg/L	
210615Q059	5	Kitchen Potfiller Left-PF; Initial	1.00	<1.00	µg/L	
210615Q060	6	Kitchen Potfiller Right-PF; Initial	1.00	1.44	µg/L	
210615Q061	7	Kitchen Island 2-SK; Initial	1.00	<1.00	µg/L	
210615Q062	8	Kitchen Bathroom-SK; Initial	1.00	1.01	µg/L	
210615Q063	9	Kitchen Pizza & Burger Serving Line-SK; Initial	1.00	11.3	µg/L	
210615Q064	10	Kitchen Tiger Deli Serving Line Left-SK; Initial	1.00	5.41	µg/L	
210615Q065	11	Kitchen Tiger Deli Serving Line Right-SK; Initial	1.00	1.26	µg/L	
210615Q066	12	Cafeteria Left-BF; Initial	1.00	<1.00	µg/L	
210615Q067	13	Faculty Dining-SK; Initial	1.00	<1.00	µg/L	
210615Q068	14	Room C203-SK; Initial	1.00	4.76	µg/L	
210615Q069	15	Room C202 Station 1-SK; Initial	1.00	<1.00	µg/L	
210615Q070	16	Room C202 Station 2-SK; Initial	1.00	<1.00	µg/L	
210615Q071	17	Room C202 Station 3-SK; Initial	1.00	<1.00	µg/L	
210615Q072	18	Room C201-SK; Initial	1.00	1.59	µg/L	
210615Q073	19	Men's Bathroom by Faculty Room C224 Left-SK; Initial	1.00	<1.00	µg/L	
210615Q074	20	Men's Bathroom by Faculty Room C224 Right-SK; Initial	1.00	<1.00	µg/L	
210615Q075	21	Women's Bathroom by Faculty Room 224 Left-SK; Initial	1.00	1.62	µg/L	
210615Q076	22	Women's Bathroom by Faculty Room 224 Right-SK; Initial	1.00	<1.00	µg/L	
210615Q077	23	Hall by Room C208-BF; Initial	1.00	<1.00	µg/L	
210615Q078	24	Women's Bathroom by Pool Left-SK; Initial	1.00	4.96	µg/L	
210615Q079	25	Women's Bathroom by Pool Right-SK; Initial	1.00	2.13	µg/L	
210615Q080	26	Hall by Pool-BF; Initial	1.00	<1.00	µg/L	



Date Collected:	15 Jun 2021
Date Received:	15 Jun 2021
Date Analyzed:	16 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210615Q081	27	Men's Bathroom by Pool Left-SK; Initial	1.00	4.99	µg/L	
210615Q082	28	Men's Bathroom by Pool Right-SK; Initial	1.00	2.26	µg/L	
210615Q083	29	Guidance Suite-BF; Initial	1.00	<1.00	µg/L	
210615Q084	30	Main Office Principal's Bathroom-SK; Initial	1.00	<1.00	µg/L	
210615Q085	31	Women's Bathroom by Board Room Left-SK; Initial	1.00	1.76	µg/L	
210615Q086	32	Women's Bathroom by Board Room Right-SK; Initial	1.00	3.83	µg/L	
210615Q087	33	Men's Bathroom by Board Room Left-SK; Initial	1.00	9.59	µg/L	
210615Q088	34	Men's Bathroom by Board Room Right-SK; Initial	1.00	2.51	µg/L	
210615Q089	35	ADA Bathroom by Room B201-SK; Initial	1.00	3.64	µg/L	
210615Q090	36	Boy's Bathroom by Room A218 Left-SK; Initial	1.00	<1.00	µg/L	
210615Q091	37	Boy's Bathroom by Room A218 Right-SK; Initial	1.00	<1.00	µg/L	
210615Q092	38	Hall by Room A217-BF; Initial	1.00	<1.00	µg/L	
210615Q093	39	Girl's Bathroom by Room A202 Left-SK; Initial	1.00	<1.00	µg/L	
210615Q094	40	Girl's Bathroom by Room A202 Middle-SK; Initial	1.00	<1.00	µg/L	
210615Q095	41	Girl's Bathroom by Room A202 Right-SK; Initial	1.00	<1.00	µg/L	
210615Q096	42	Hall by Room A205-BF; Initial	1.00	<1.00	µg/L	
210615Q097	43	Girl's Bathroom by Room A103 Left-SK; Initial	1.00	2.85	µg/L	
210615Q098	44	Girl's Bathroom by Room A103 Middle-SK; Initial	1.00	<1.00	µg/L	
210615Q099	45	Girl's Bathroom by Room A103 Right-SK; Initial	1.00	3.32	µg/L	
210615Q100	46	Hall by Room A105-BF; Initial	1.00	<1.00	µg/L	
210615Q101	47	Boy's Bathroom by Room A116 Left-SK; Initial	1.00	<1.00	µg/L	
210615Q102	48	Boy's Bathroom by Room A116 Right-SK; Initial	1.00	<1.00	µg/L	
210615Q103	49	Hall by Room A114-BF; Initial	1.00	<1.00	µg/L	
210615Q104	50	Lounge between Room A112 and Room A111-SK; Initial	1.00	2.46	µg/L	
210615Q105	51	ADA Bathroom by Room A116-SK; Initial	1.00	14.1	µg/L	
210615Q106	52	Men's Bathroom B410 by JROTC-SK; Initial	1.00	<1.00	µg/L	
210615Q107	53	Women's Bathroom by JROTC-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	15 Jun 2021
Date Received:	15 Jun 2021
Date Analyzed:	16 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210615Q108	54	ADA Bathroom by Room B308 / Team Center-SK; Initial	1.00	<1.00	µg/L	
210615Q109	55	Little Theatre Men's Bathroom Left-SK; Initial	1.00	3.04	µg/L	
210615Q110	56	Little Theatre Men's Bathroom Right-SK; Initial	1.00	1.14	µg/L	
210615Q111	57	Little Theatre Women's Bathroom Left-SK; Initial	1.00	1.66	µg/L	
210615Q112	58	Little Theatre Women's Bathroom Right-SK; Initial	1.00	3.53	µg/L	
210615Q113	59	Men's Faculty Bathroom by Room C104 Left-SK; Initial	1.00	12.6	µg/L	
210615Q114	60	Men's Faculty Bathroom by Room C104 Right-SK; Initial	1.00	10.4	µg/L	
210615Q115	61	Hall by Room C105B-BF; Initial	1.00	<1.00	µg/L	
210615Q116	62	Boy's Bathroom by Room 105B Left-SK; Initial	1.00	1.34	µg/L	
210615Q117	63	Boy's Bathroom by Room 105B Right-SK; Initial	1.00	7.17	µg/L	
210615Q118	64	Girl's Bathroom by Nurse's Office Left-SK; Initial	1.00	2.10	µg/L	
210615Q119	65	Girl's Bathroom by Nurse's Office Right-SK; Initial	1.00	1.27	µg/L	
210615Q120	66	Nurse's Station Exam Room 1-SK; Initial	1.00	<1.00	µg/L	
210615Q121	67	Nurse's Station Bathroom-SK; Initial	1.00	<1.00	µg/L	
210615Q122	68	Nurse's Station Exam Room 2-SK; Initial	1.00	<1.00	µg/L	
210615Q123	69	Nurse's Station Office-SK; Initial	1.00	<1.00	µg/L	
210615Q124	70	Girl's Locker Room Bathroom Left-SK; Initial	1.00	2.98	µg/L	
210615Q125	71	Girl's Locker Room Bathroom Right-SK; Initial	1.00	1.04	µg/L	
210615Q126	72	Hall by Girl's Locker Room-BF; Initial	1.00	<1.00	µg/L	
210615Q127	73	Boy's Bathroom by Gym Left-SK; Initial	1.00	5.27	µg/L	
210615Q128	74	Boy's Bathroom by Gym Middle-SK; Initial	1.00	4.34	µg/L	
210615Q129	75	Boy's Bathroom by Gym Right-SK; Initial	1.00	7.51	µg/L	
210615Q130	76	Boy's Locker Room Coach's Office Bathroom-SK; Initial	1.00	4.56	µg/L	
210615Q131	77	Boy's Locker Room Bathroom Left-SK; Initial	1.00	<1.00	µg/L	
210615Q132	78	Boy's Locker Room Bathroom Right-SK; Initial	1.00	<1.00	µg/L	
210615Q133	79	Pool Boy's Locker Room-WF; Initial	1.00	3.08	µg/L	
210615Q134	80	Pool Boy's Locker Room Bathroom Left-SK; Initial	1.00	2.47	µg/L	



Date Collected:	15 Jun 2021
Date Received:	15 Jun 2021
Date Analyzed:	16 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210615Q135	81	Pool Boy's Locker Room Bathroom Right-SK; Initial	1.00	1.97	µg/L	
210615Q136	82	Pool Coach's Office-SK; Initial	1.00	5.57	µg/L	
210615Q137	83	Pool Girl's Locker Room-WF; Initial	1.00	<1.00	µg/L	
210615Q138	84	Pool Girl's Locker Room Bathroom Left-SK; Initial	1.00	1.13	µg/L	
210615Q139	85	Pool Girl's Locker Room Bathroom Right-SK; Initial	1.00	<1.00	µg/L	
210615Q140	86	Pool Swimming Instructor Bathroom-SK; Initial	1.00	3.26	µg/L	
210615Q141	87	Athletic Trainer Room-IM; Initial	1.00	<1.00	µg/L	
210615Q142	88	Athletic Trainer Room-SK; Initial	1.00	3.03	µg/L	
210615Q143	89	Girl's Locker Room Coach's Office Bathroom-SK; Initial	1.00	<1.00	µg/L	
210615Q144	90	Boy's Bathroom by Room A314 Left-SK; Initial	1.00	<1.00	µg/L	
210615Q145	91	Boy's Bathroom by Room A314 Right-SK; Initial	1.00	<1.00	µg/L	
210615Q146	92	Men's Bathroom by Room A314 Left-SK; Initial	1.00	18.1	µg/L	H
210615Q147	93	Men's Bathroom by Room A314 Middle-SK; Initial	1.00	1.08	µg/L	
210615Q148	94	Men's Bathroom by Room A314 Right-SK; Initial	1.00	5.77	µg/L	
210615Q149	95	Hall by Room A313-BF; Initial	1.00	<1.00	µg/L	
210615Q150	96	Hall by Room A305-BF; Initial	1.00	<1.00	µg/L	
210615Q151	97	Women's Bathroom by Room A303 Left-SK; Initial	1.00	3.62	µg/L	
210615Q152	98	Women's Bathroom by Room A303 Right-SK; Initial	1.00	2.15	µg/L	
210615Q153	99	Girl's Bathroom by Room A303 Left-SK; Initial	1.00	1.25	µg/L	
210615Q154	100	Girl's Bathroom by Room A303 Middle-SK; Initial	1.00	3.13	µg/L	
210615Q155	101	Girl's Bathroom by Room A303 Right-SK; Initial	1.00	1.75	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2212806-18243

June 18, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Hempstead High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 17, 2021. New York Environmental analyzed the samples on June 18, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	16 Jun 2021
Date Received:	17 Jun 2021
Date Analyzed:	18 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210617Q135	1	Athletic Director's Office-SK; Initial	1.00	28.1	µg/L	H

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Appendix K

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-01	Custodial Closet by Book Room	SS	N/A		6/17/2021	-	-	-	None	Locked Door	-	-
0002-01	Book Room Unit Left	SK	N/A		6/17/2021	-	-	-	Sign Required	-	-	-
0002-02	Book Room Unit Left	SK	N/A		6/17/2021	-	-	-	Sign Required	-	-	-
0002-03	Book Room Unit Right	SK	N/A		6/17/2021	-	-	-	Sign Required	-	-	-
0003-01	Basement Bathroom	SK	App	2.8	6/17/2021	-	-	-	None	-	-	-
1001-01	Kitchen 2-Bay Left	SK	App	10.6	6/17/2021	-	-	-	None	-	-	-
1001-02	Kitchen 2-Bay Right	SK	App	13.6	6/17/2021	-	-	-	None	-	-	-
1001-03	Kitchen Coffee Area	SK	App	1.53	6/17/2021	-	-	-	None	-	-	-
1002-01	Bathroom by Main Entrance	SK	App	1.76	6/17/2021	-	-	-	None	-	-	-
1003-01	Custodial Closet by Kitchen	SS	N/A		6/17/2021	-	-	-	Sign Required	Locked Door	-	-
1004-01	Bathroom by Conference Room	SK	App	<1.0	6/17/2021	-	-	-	None	-	-	-
2001-01	Room 1 Bathroom	SK	App	157	6/17/2021				Additional Sampling Required	-	-	-
2002-01	Custodial Closet by Room 4	SS	N/A		6/17/2021	-	-	-	None	Locked Door	-	-
2003-01	Bathroom by Room 5 Left	SK	App	9.63	6/17/2021	-	-	-	None	-	-	-
2003-02	Bathroom by Room 5 Right	SK	App	7.29	6/17/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212805-18242

June 21, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Pupil Personnel Services Building

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 17, 2021. New York Environmental analyzed the samples on June 18, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	17 Jun 2021
Date Received:	17 Jun 2021
Date Analyzed:	18 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210617Q126	1	Basement Bathroom-SK; Initial	1.00	2.80	µg/L	
210617Q127	2	Kitchen 2-Bay Left-SK; Initial	1.00	10.6	µg/L	
210617Q128	3	Kitchen 2-Bay Right-SK; Initial	1.00	13.6	µg/L	
210617Q129	4	Kitchen Coffee Area-SK; Initial	1.00	1.53	µg/L	
210617Q130	5	Bathroom by Main Entrance-SK; Initial	1.00	1.76	µg/L	
210617Q131	6	Bathroom by Conference Room-SK; Initial	1.00	<1.00	µg/L	
210617Q132	7	Room 1 Bathroom-SK; Initial	1.00	157	µg/L	E,H
210617Q133	8	Bathroom by Room 5 Left-SK; Initial	1.00	9.63	µg/L	
210617Q134	9	Bathroom by Room 5 Right-SK; Initial	1.00	7.29	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix L

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001 1	Hall by Room 119 Left	WF	App	1.29	6/16/2021	-	-	-	None	-	-	-
1001 2	Hall by Room 119 Right	WF	App	2.13	6/16/2021	-	-	-	None	-	-	-
1002 1	Girl's Bathroom by Computer Lab B Left	SK	App	1.57	6/16/2021	-	-	-	None	-	-	-
1002 2	Girl's Bathroom by Computer Lab B Left Middle	SK	App	42.7	6/16/2021				Additional Sampling Required			
1002 3	Girl's Bathroom by Computer Lab B Right Middle	SK	App	29.1	6/16/2021				Additional Sampling Required			
1002 4	Girl's Bathroom by Computer Lab B Left	SK	App	<1.0	6/16/2021	-	-	-	None	-	-	-
1003 1	Women's Bathroom by Computer Lab B	SK	App	70.9	6/16/2021				Additional Sampling Required			
1004 1	Boy's Bathroom by Data Office Left	SK	App	2.93	6/16/2021	-	-	-	None	-	-	-
1004 2	Boy's Bathroom by Data Office Left Middle	SK	App	43.6	6/16/2021				Additional Sampling Required			
1004 3	Boy's Bathroom by Data Office Right	SK	App	15.5	6/16/2021				Additional Sampling Required			
1004 4	Boy's Bathroom by Data Office Right Middle	SK	App	7.96	6/16/2021	-	-	-	None	-	-	-
1004 5	Boy's Bathroom Custodial Closet	SS	N/A		6/16/2021	-	-	-	None	Locked Door	-	-
1005 1	Men's Bathroom by Telecommunications	SK	App	20.5	6/16/2021				Additional Sampling Required			
1006 1	Faculty Room Kitchenette	SK	App	6.87	6/16/2021	-	-	-	None	-	-	-
1007 1	Hanidicap Bathroom by Custodial Office	SK	App	1.61	6/16/2021	-	-	-	None	-	-	-
1008 1	Hall by Custodial Office Handwash	SK	App		6/16/2021	-	-	-	Sign Required	-	-	-

Laboratory Report

NYE Report #: 2212808-18245

June 21, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Administration Building

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 17, 2021. New York Environmental analyzed the samples on June 18, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	16 Jun 2021
Date Received:	17 Jun 2021
Date Analyzed:	18 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210617Q166	1	Hall by Room 119 Left-WF; Initial	1.00	1.29	µg/L	
210617Q167	2	Hall by Room 119 Right-WF; Initial	1.00	2.13	µg/L	
210617Q168	3	Girl's Bathroom by Computer Lab B Left-SK; Initial	1.00	1.57	µg/L	
210617Q169	4	Girl's Bathroom by Computer Lab B Left Middle-SK; Initial	1.00	42.7	µg/L	H
210617Q170	5	Girl's Bathroom by Computer Lab B Right Middle-SK; Initial	1.00	29.1	µg/L	H
210617Q171	6	Girl's Bathroom by Computer Lab B Left-SK; Initial	1.00	<1.00	µg/L	
210617Q172	7	Women's by Computer Lab B-SK; Initial	1.00	70.9	µg/L	E,H
210617Q173	8	Boy's Bathroom by Data Office Left-SK; Initial	1.00	2.93	µg/L	
210617Q174	9	Boy's Bathroom by Data Office Left Middle-SK; Initial	1.00	43.6	µg/L	H
210617Q175	10	Boy's Bathroom by Data Office Right-SK; Initial	1.00	15.5	µg/L	H
210617Q176	11	Boy's Bathroom by Data Office Right Middle-SK; Initial	1.00	7.96	µg/L	
210617Q177	12	Men's Bathroom by Telecommunications-SK; Initial	1.00	20.5	µg/L	H
210617Q178	13	Faculty Room Kitchenette-SK; Initial	1.00	6.87	µg/L	
210617Q179	14	Hanidicap Bathroom by Custodial Office-SK; Initial	1.00	1.61	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.